



CONDITION REPORT



Report No:
2017304156
DATE
28/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	28/09/2026		M57 Pretoria Road - 1619
Inspection Date	28/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	BMW	Registration Number	FW49WVGP
Model	118I HATCH 5-DR STEPTRONIC [2016-2019]	Register Number	
VIN	WBA1R520205C74209	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/04/2026
Color	WHITE	Power / Displacement	
Year Model	2017	Paint Finish	C - COMMON
Km Reading	224,338 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA1R520205C74209



CONDITION REPORT



Report No:

2017304156

DATE

28/09/2026



Damage

Repair Way

Headlight Left Damaged	Replace
Seat Front Right Damaged	Repair
Side Mirror Right Paintwork • Scratched	Repair
Front Bumper Paintwork • Scratched	Repair
Bonnet Paintwork • Chipmarks	Repair
Front Fender Right Paintwork • Scratched	Repair
Rear Fender Right Dented	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Dented	Repair
Rear bumper Paintwork • Scratched	Repair
Windscreen Cracked	Replace
Speed Sensor Damaged	Repair
Parking Brake Performance Left / Right Difference out of legal range	Repair
Bolt(s) / Nut(s) Front Wheel Left Missing	Replace
Bolt(s) / Nut(s) Front Wheel Right Missing	Replace
Bolt(s) / Nut(s) Rear Wheel Left Missing	Replace
Bolt(s) / Nut(s) Rear Wheel Right Missing	Replace

Brakes

Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	3.0	2.8	-	
Rear	3.0	3.1	-	
Emergency / Parking	1	2.5	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	205/55R16	91V	Goodyear	Eagle	V	2906	1 mm
Front Right	205/55R16	91W	Dunlop	Sp sport	V	0416	3 mm
Rear Left	205/55R16	91V	Continental	Contact	V	4123	3 mm
Rear Right	205/55R16	91V	Continental	Contact	V	3923	3 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA1R520205C74209



CONDITION REPORT



Report No:
2017304156
DATE
28/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	INTERMITTENT	4809AB	DSC: UNDERVOLTAGE IN VEHICLE	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA1R520205C74209




CONDITION REPORT




Report No:

2017304156

DATE _____

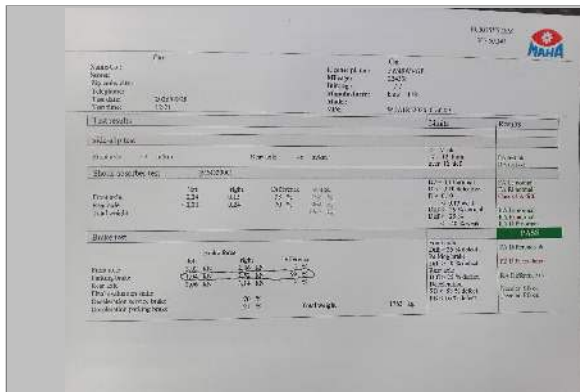

Shock and brake report

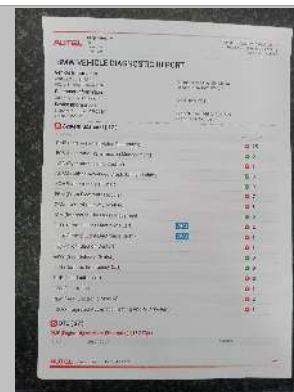

Diagnostic report



Diagnostic report



Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA1R520205C74209



CONDITION REPORT



Report No:
2017304156
DATE
28/09/2026



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic



90 DEGREE FRONT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA1R520205C74209



CONDITION REPORT



Report No:
2017304156
DATE
28/09/2026




90 DEGREE REAR




90 DEGREE LEFT




LF TYRE TREAD

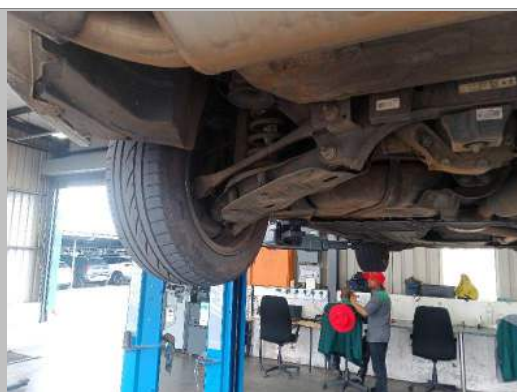

LR TYRE TREAD

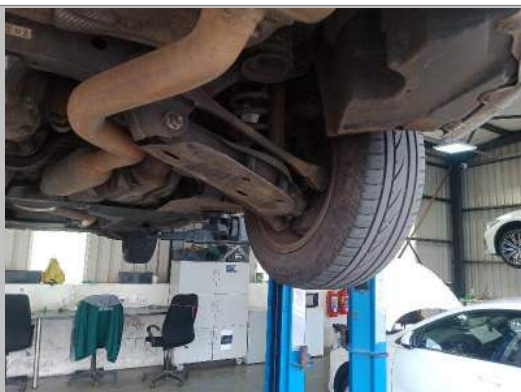

RR TYRE TREAD

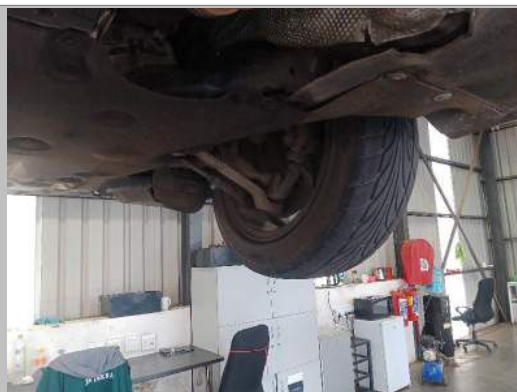

RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA1R520205C74209



CONDITION REPORT



Report No:

2017304156

DATE

28/09/2026



No spare wheel



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA1R520205C74209



CONDITION REPORT



Report No:
2017304156
DATE
28/09/2026



Expenditure bottle



Oil cap



Seat Front Right



Windscreen

Vehicle Data		Engine Data		Gearbox Data		Transmission Data	
Make	Model	Year	Engine	Gearbox	Transmission	Make	Model
Volvo	V40	2016	2.0 T4	6-Speed	Automatic	Volvo	V40
Engine	Power	Torque	Gearbox	Transmission	Make	Model	Year
2000 cc	125 kW	235 Nm	6-Speed	Automatic	Volvo	V40	2016
Engine	Power	Torque	Gearbox	Transmission	Make	Model	Year
2000 cc	125 kW	235 Nm	6-Speed	Automatic	Volvo	V40	2016

Parking Brake Performance



Headlight Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA1R520205C74209



CONDITION REPORT



Report No:

2017304156

DATE

28/09/2026



Bonnet



Front Bumper



Front Bumper



Water level



Side Mirror Right



Door Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA1R520205C74209



CONDITION REPORT



Report No:
2017304156
DATE
28/09/2026



Door Rear Right



Rear Fender Right



Front Fender Right



Door Rear Left



Rear bumper



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA1R520205C74209



CONDITION REPORT



Report No:
2017304156
DATE
28/09/2026



Bolt(s) / Nut(s) Rear Wheel Right



Bolt(s) / Nut(s) Rear Wheel Left



Bolt(s) / Nut(s) Front Wheel Left



Bolt(s) / Nut(s) Front Wheel Right



Speed Sensor

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA1R520205C74209