



CONDITION REPORT



Report No:
2017297402
DATE
11/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	11/09/2026		M57 Pretoria Road - 1619
Inspection Date	11/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	BMW	Registration Number	LY94PTGP
Model	X1 XLINE SDRIVE18I SAV STEPTRONIC [2022-ON]	Register Number	
		Date Of First Licensing	
VIN	WBA22EE0905Z97797	Last COR	
Engine Number		License Expiry Date	31/05/2027
Doors	5	Power / Displacement	
Color	WHITE	Paint Finish	PEARL EFFECT
Year Model	2024	Fuel	PETROL
Km Reading	49,073 KM	Transmission	AUTOMATIC
Cab / Body Type	STATION WAGON		

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA22EE0905Z97797




CONDITION REPORT



Report No:
2017297402
DATE
11/09/2026

Damage	Repair Way
Front Bumper Paintwork • Chipmarks	Repair

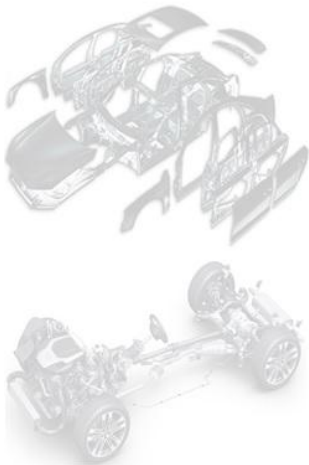

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.67	3.97	-	
Rear	4.4	2.48	-	
Emergency / Parking	2	2.12	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	245/45R19	102Y	Pirelli	Radial	V	1724	2 mm
Front Right	245/45R19	102Y	Pirelli	Radial	V	1724	2 mm
Rear Left	245/45R19	102Y	Pirelli	Radial	V	1724	3 mm
Rear Right	245/45R19	102Y	Pirelli	Radial	V	1724	3 mm
Spare	T135/80R17	103M	Maxxis	Temporary	V	0000	3 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA22EE0905Z97797



CONDITION REPORT



Report No:
2017297402
DATE
11/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	DMW	034DC1	HIGH PRESSURE FUEL SYSTEM, RAIL PRESSURE SENSOR, AFTER - RUN: RELATIVELY FAST PRESSURE DROP	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. 47 DTC'S AT TIME OF TESTING SEE DTC REPORT. Body • Exterior: Minor dents and scratches and stone chips to body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA22EE0905Z97797



CONDITION REPORT



Report No:
2017297402
DATE
11/09/2026

Vehicle Information		Engine Information		Transmission Information	
Brand/Model	DAEWOO	Engine/Type	1.8L	Transmission	5-Speed
Year/Version	2011	Power/Output	100 kW	Gearbox	Manual
Chassis No.	20110011	Registration	1000000000000000000	Vehicle Weight	1500 kg
Vehicle	DAEWOO	Engine	1.8L	Transmission	5-Speed
Year/Version	2011	Power/Output	100 kW	Gearbox	Manual
Chassis No.	20110011	Registration	1000000000000000000	Vehicle Weight	1500 kg
Vehicle	DAEWOO	Engine	1.8L	Transmission	5-Speed
Year/Version	2011	Power/Output	100 kW	Gearbox	Manual
Chassis No.	20110011	Registration	1000000000000000000	Vehicle Weight	1500 kg

Brake and shock absorber

Brake and shock absorber		Engine Information		Transmission Information	
Brand/Model	DAEWOO	Engine/Type	1.8L	Transmission	5-Speed
Year/Version	2011	Power/Output	100 kW	Gearbox	Manual
Chassis No.	20110011	Registration	1000000000000000000	Vehicle Weight	1500 kg
Vehicle	DAEWOO	Engine	1.8L	Transmission	5-Speed
Year/Version	2011	Power/Output	100 kW	Gearbox	Manual
Chassis No.	20110011	Registration	1000000000000000000	Vehicle Weight	1500 kg
Vehicle	DAEWOO	Engine	1.8L	Transmission	5-Speed
Year/Version	2011	Power/Output	100 kW	Gearbox	Manual
Chassis No.	20110011	Registration	1000000000000000000	Vehicle Weight	1500 kg

Diagnostic report

Brake and shock absorber		Engine Information		Transmission Information	
Brand/Model	DAEWOO	Engine/Type	1.8L	Transmission	5-Speed
Year/Version	2011	Power/Output	100 kW	Gearbox	Manual
Chassis No.	20110011	Registration	1000000000000000000	Vehicle Weight	1500 kg
Vehicle	DAEWOO	Engine	1.8L	Transmission	5-Speed
Year/Version	2011	Power/Output	100 kW	Gearbox	Manual
Chassis No.	20110011	Registration	1000000000000000000	Vehicle Weight	1500 kg
Vehicle	DAEWOO	Engine	1.8L	Transmission	5-Speed
Year/Version	2011	Power/Output	100 kW	Gearbox	Manual
Chassis No.	20110011	Registration	1000000000000000000	Vehicle Weight	1500 kg

Diagnostic report

Brake and shock absorber		Engine Information		Transmission Information	
Brand/Model	DAEWOO	Engine/Type	1.8L	Transmission	5-Speed
Year/Version	2011	Power/Output	100 kW	Gearbox	Manual
Chassis No.	20110011	Registration	1000000000000000000	Vehicle Weight	1500 kg
Vehicle	DAEWOO	Engine	1.8L	Transmission	5-Speed
Year/Version	2011	Power/Output	100 kW	Gearbox	Manual
Chassis No.	20110011	Registration	1000000000000000000	Vehicle Weight	1500 kg
Vehicle	DAEWOO	Engine	1.8L	Transmission	5-Speed
Year/Version	2011	Power/Output	100 kW	Gearbox	Manual
Chassis No.	20110011	Registration	1000000000000000000	Vehicle Weight	1500 kg

Diagnostic report

Brake and shock absorber		Engine Information		Transmission Information	
Brand/Model	DAEWOO	Engine/Type	1.8L	Transmission	5-Speed
Year/Version	2011	Power/Output	100 kW	Gearbox	Manual
Chassis No.	20110011	Registration	1000000000000000000	Vehicle Weight	1500 kg
Vehicle	DAEWOO	Engine	1.8L	Transmission	5-Speed
Year/Version	2011	Power/Output	100 kW	Gearbox	Manual
Chassis No.	20110011	Registration	1000000000000000000	Vehicle Weight	1500 kg
Vehicle	DAEWOO	Engine	1.8L	Transmission	5-Speed
Year/Version	2011	Power/Output	100 kW	Gearbox	Manual
Chassis No.	20110011	Registration	1000000000000000000	Vehicle Weight	1500 kg

Diagnostic report

Brake and shock absorber		Engine Information		Transmission Information	
Brand/Model	DAEWOO	Engine/Type	1.8L	Transmission	5-Speed
Year/Version	2011	Power/Output	100 kW	Gearbox	Manual
Chassis No.	20110011	Registration	1000000000000000000	Vehicle Weight	1500 kg
Vehicle	DAEWOO	Engine	1.8L	Transmission	5-Speed
Year/Version	2011	Power/Output	100 kW	Gearbox	Manual
Chassis No.	20110011	Registration	1000000000000000000	Vehicle Weight	1500 kg
Vehicle	DAEWOO	Engine	1.8L	Transmission	5-Speed
Year/Version	2011	Power/Output	100 kW	Gearbox	Manual
Chassis No.	20110011	Registration	1000000000000000000	Vehicle Weight	1500 kg

Diagnostic report

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA22EE0905Z97797



CONDITION REPORT



Report No:

2017297402

DATE

11/09/2026



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA22EE0905Z97797



CONDITION REPORT



Report No:
2017297402
DATE
11/09/2026




90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

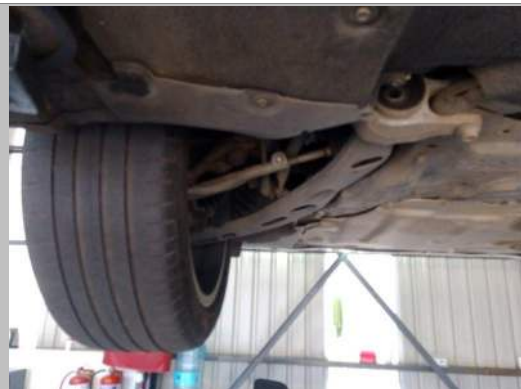

LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA22EE0905Z97797



CONDITION REPORT



Report No:

2017297402

DATE

11/09/2026



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ADDITIONAL 7



ADDITIONAL 8

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za


VIN: WBA22EE0905Z97797



CONDITION REPORT



Report No:
2017297402
DATE
11/09/2026

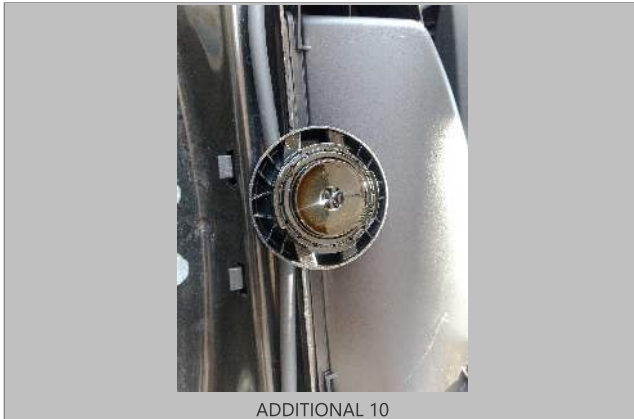

ADDITIONAL 10



Water level



Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA22EE0905Z97797