



CONDITION REPORT

Report No: 2016733166

DATE
24/01/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	24/01/2025		M57 Pretoria Road - 1619
Inspection Date	24/01/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	BMW	Registration Number	KP68YHGP
Model	730D DSL SPORT STEPTRONIC [2016-2019]	Register Number	
VIN	WBA7C22090G545181	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	31/05/2023
Color	GREY	Power / Displacement	
Year Model	2016	Paint Finish	M - METALLIC
Km Reading	191,605 KM	Fuel	DIESEL
Cab / Body Type	SEDAN	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Switch Electrical Window Winder rear left Defective	Repair
Switch Electrical Window Winder rear right Defective	Repair
Front Bumper Paintwork • Scratched	Repair
Stabilizer Mounting Front Left Missing	Replace
Tyre Front Right Torn / Cut	Replace
Bolt(s) / Nut(s) Front Wheel Left Missing	Replace
Steering Malfunction	Repair
Vehicle electronics malfunction.	Repair.
Vehicle has no battery	Replace.
Warning lights illuminated	Repair

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA7C22090G545181

1 / 9



CONDITION REPORT

Report No: 2016733166

DATE
24/01/2025

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	4.1	3.6	-	
Rear	3.0	3.2	-	
Emergency / Parking	2.2	2.2	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	245/40R20	99Y	Apollo	Aspire	V	3922	6 mm
Front Right	245/40R20	99Y	Goodyear	Excellence	V	4119	3 mm
Rear Left	275/35R20	102W	Blackhawk	Hiscend	V	2722	6 mm
Rear Right	275/35R20	102Y	Goodyear	Excellence	V	4119	7 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ELECTRIC POWER STEERING	4822E5	EPS CONTROL UNIT INITIALISATION FAULT OF STEERING	
2	ENGINE DIESEL ELECTRONICS	300C00	DDE MAIN RELAY SWITCHES OFF TOO EARLY OR UNDER VOL	

Inspection Conditions

No Test Drive
Vehicle doesn't start
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Engine Compartment: Bottom of engine is fully covered.
Body • Exterior: Minor dents scratches stone chips on some body panels. Signs of spray work done on some body panels
Undercarriage: Undercarriage is fully covered.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.


General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za




CONDITION REPORT

Report No: 2016733166

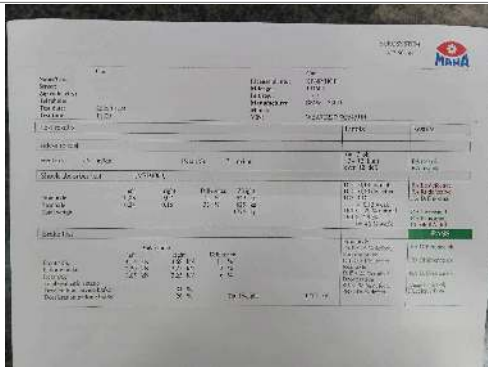DATE
24/01/2025


Shock and brake report

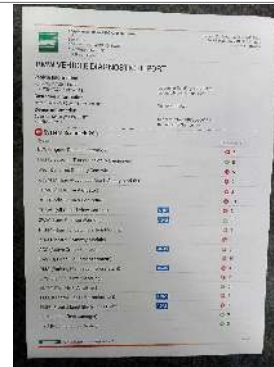


Diagnostic test

N: WBA7C22090G545181

2 / 9

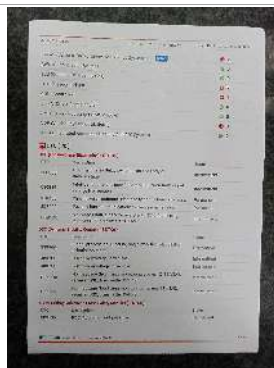


Diagnostic test

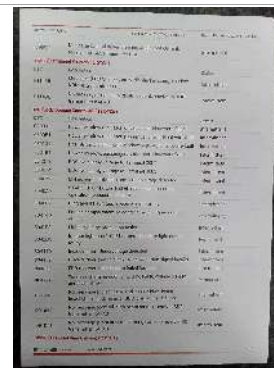

Diagnostic test



Diagnostic test

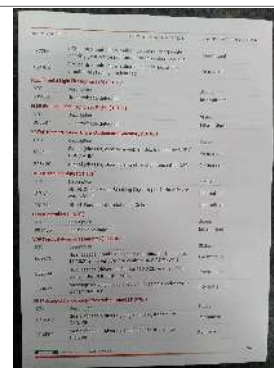

Diagnostic test

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016733166

DATE
24/01/2025

VIN: WBA7C22090G545181


3 / 9

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016733166

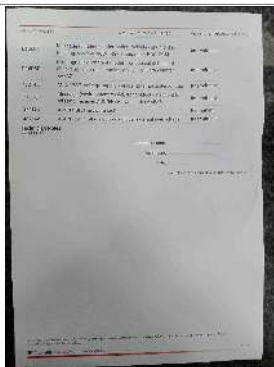DATE
24/01/2025

Diagnostic test



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016733166

DATE
24/01/2025

VIN: WBA7C22090G545181

5 / 9

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016733166

DATE
24/01/2025

Automatic



90 DEGREE FRONT




90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

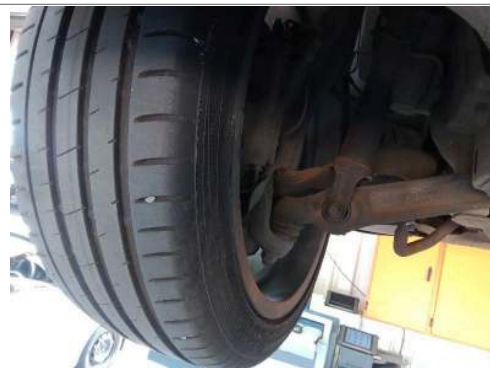

LF TYRE TREAD

VIN: WBA7C22090G545181

6 / 9

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

**CONDITION REPORT****Report No: 2016733166****DATE**
24/01/2025

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA7C22090G545181



CONDITION REPORT

 / / 9
 Report No: 2016733166

 DATE
 24/01/2025


LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



No sparewheel



LICENSE DISC



VIN PLATE OR STICKER

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

**CONDITION REPORT****Report No: 2016733166****DATE**
24/01/2025

VIN: WBA7C22090G545181

8 / 9

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016733166

DATE
24/01/2025

Warning lights illuminated



ENGINE 1

VIN: WBA7C22090G545181


9 / 9



ENGINE 2



CHASSIS

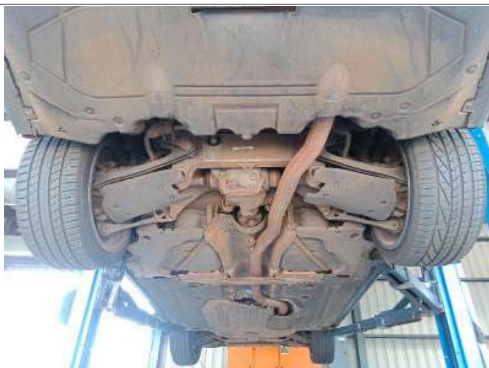

Rear end



Warning lights illuminated

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

**CONDITION REPORT****Report No: 2016733166****DATE**
24/01/2025

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016733166

DATE
24/01/2025

No battery



Expansion bottle



Oil cap and dipstick



Switch Electrical Window Winder rear left



Switch Electrical Window Winder rear right



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

**CONDITION REPORT****Report No: 2016733166****DATE**
24/01/2025

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016733166

DATE
24/01/2025

Tyre Front Right



Bolt(s) / Nut(s) Front Wheel Left



Front Bumper



Stabilizer Mounting Front Left



Stabilizer Mounting Front Left



Stabilizer Mounting Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

**CONDITION REPORT****Report No: 2016733166****DATE**
24/01/2025

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za