



CONDITION REPORT



Report No:
2017303554
DATE
25/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	25/09/2026		M57 Pretoria Road - 1619
Inspection Date	25/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	BMW	Registration Number	LCM386NW
Model	320I STEPTRONIC [2015-2019]	Register Number	
VIN	WBA8A16000NU73894	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	
Color	WHITE	Power / Displacement	
Year Model	2017	Paint Finish	C - COMMON
Km Reading	89,041 KM	Fuel	PETROL
Cab / Body Type		Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA8A16000NU73894



CONDITION REPORT



Report No:

2017303554


DATE

25/09/2026

Damage

Repair Way

Front Bumper Paintwork • Scratched	Repair
Bonnet Paintwork • Scratched	Repair
Front Fender Right Paintwork • Scratched	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Right Paintwork • Scratched	Repair
Shock Absorber Front Left Leak	Replace
Shock Absorber Front Right Leak	Replace
Stabilizer Mounting Front Left Damaged	Replace
Stabilizer Mounting Front Right Damaged	Replace
Warning lights illuminated	Signs of spray work done on body panels

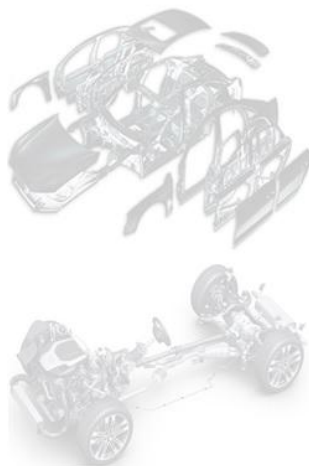

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.9	2.7	-	
Rear	2.4	2.6	-	
Emergency / Parking	1.7	1.5	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	225/55R16	95W	Continental	Contact	V	1823	3 mm
Front Right	225/55R16	95W	Continental	Contact	V	1823	3 mm
Rear Left	225/55R16	99V	Roadking	Argos	V	1025	6 mm
Rear Right	225/55R16	99V	Roadking	Argos	V	1025	6 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA8A16000NU73894



CONDITION REPORT



Report No:
2017303554
DATE
25/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENGINE MOTOR ELECTRONICS	213901	POWER MANAGEMENT: REDUCTION OR SHUTDOWN	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ENGINE & UNDERCARRIAGE IS FULLY COVERED. ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA8A16000NU73894



CONDITION REPORT



Report No:

2017303554

DATE

25/09/2026



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE FRONT



90 DEGREE REAR



90 DEGREE LEFT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA8A16000NU73894



CONDITION REPORT



Report No:

2017303554

DATE

25/09/2026



ODOMETER



DASHBOARD (W/ ENGINE RUNNING)



INTERIOR (FRONT DRIVER DOOR)



Automatic transmission



Tyre pressure warning lights



RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: WBA8A16000NU73894




CONDITION REPORT



Report No:
2017303554
DATE
25/09/2026

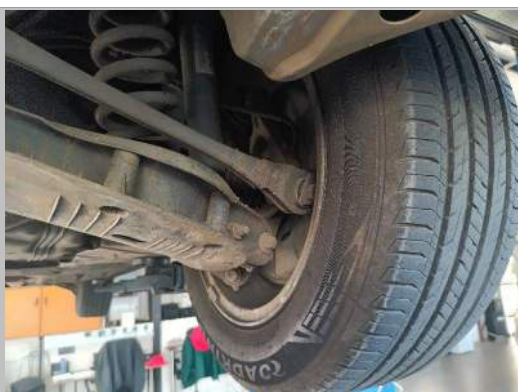

RR TYRE TREAD

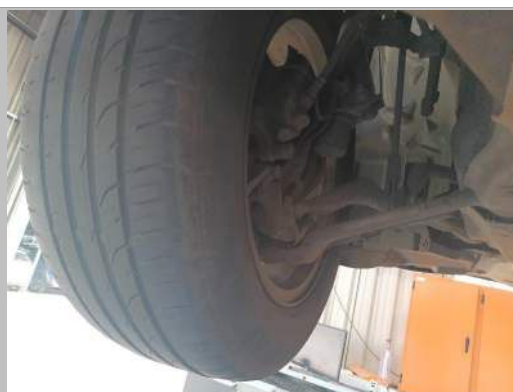

LF TYRE TREAD



LR TYRE TREAD



No sparewheel



Expansion bottle



Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: WBA8A16000NU73894



CONDITION REPORT



Report No:
2017303554
DATE
25/09/2026

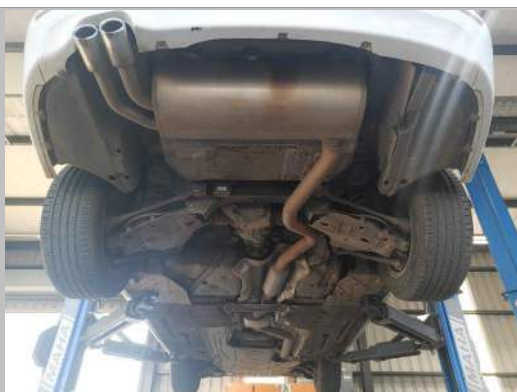

REAR



ENGINE 1



ENGINE 2



CHASSIS



VIN PLATE OR STICKER



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA8A16000NU73894



CONDITION REPORT




Report No:


2017303554

DATE


25/09/2026

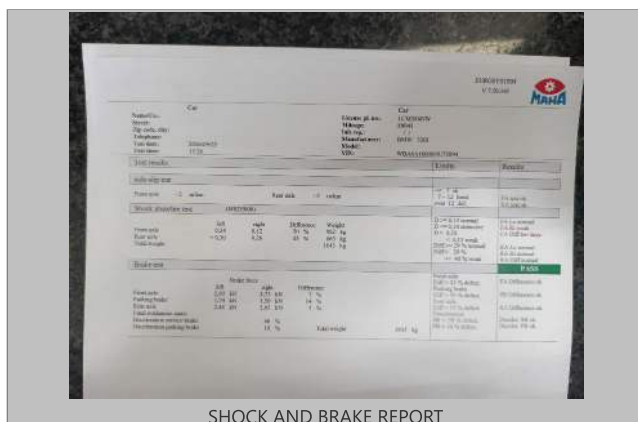


SHOCK AND BRAKE REPORT

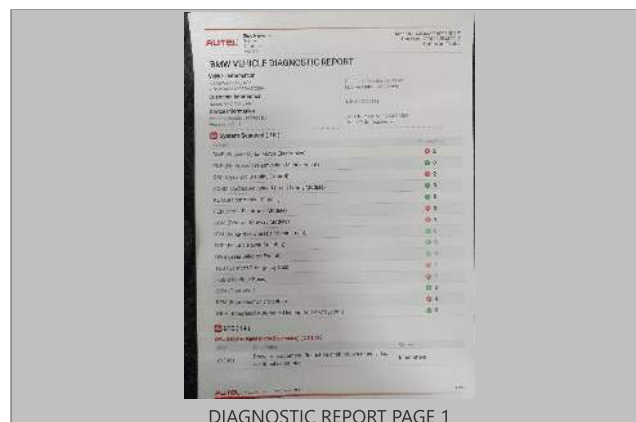


DIAGNOSTIC REPORT PAGE 1

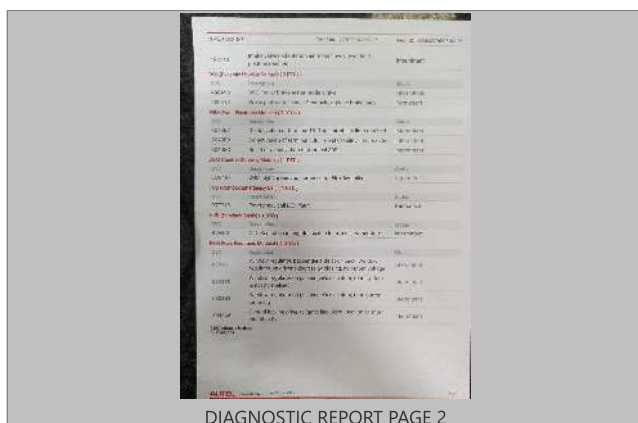

DIAGNOSTIC REPORT PAGE 2

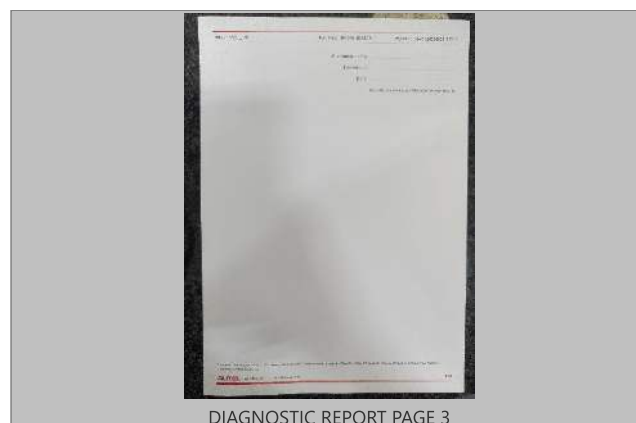

DIAGNOSTIC REPORT PAGE 3

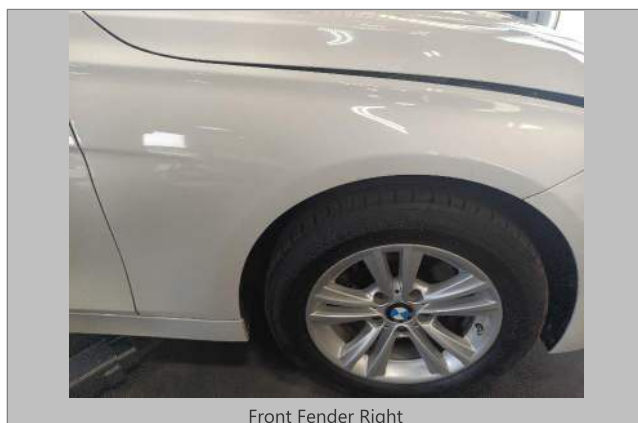

Front Fender Right



Door Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA8A16000NU73894



CONDITION REPORT



Report No:

2017303554

DATE

25/09/2026



Door Front Right



Door Rear Right



Bonnet



Stabilizer Mounting Front Right



Shock Absorber Front Right



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA8A16000NU73894



CONDITION REPORT



Report No:
2017303554
DATE
25/09/2026



Shock Absorber Front Left



Stabilizer Mounting Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA8A16000NU73894