



CONDITION REPORT



Report No:
2016960965
DATE
29/07/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	29/07/2025		M57 Pretoria Road - 1619
Inspection Date	29/07/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	BMW	Registration Number	HW79XCGP
Model	318I IMPORT AT [2019-2019]	Register Number	
VIN	WBA8E32030A554420	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	31/01/2026
Color	GREY	Power / Displacement	
Year Model	2018	Paint Finish	TWO COAT METALLIC
Km Reading	77,155 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: WBA8E32030A554420



CONDITION REPORT



Report No:
2016960965
DATE
29/07/2025

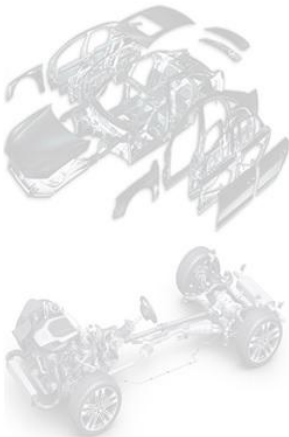	Damage	Repair Way
	Headlight Left Defective	Repair
	Front Bumper Damaged	Repair
	Bonnet Damaged	Repair
	Front Fender Left Damaged	Repair
	Front Fender Right Damaged	Repair
	Rear Fender Left Damaged	Repair
	Rear Fender Right Damaged	Repair
	Door Front Left Damaged	Repair
	Door Front Right Damaged	Repair
	Door Rear Left Damaged	Repair
	Door Rear Right Damaged	Repair
	Boot Lid / Hatch door Damaged	Repair
	Rear bumper Damaged	Repair
	Engine mountings Damaged	Replace
	Gearbox Mountings Damaged	Replace

Brakes
Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s²]
	Braking Force [KN]	Braking Force [KN]		
Front	2.84	2.97	-	
Rear	2.26	2.3	-	
Emergency / Parking	2.28	2.29	-	

Tyres and Rims
Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	225/45R18	95W	Royal black	Radial	V	1324	3 mm
Front Right	225/45R18	95Y	Bridgestone	Radial	V	0924	2 mm
Rear Left	255/40R18	99Y	Bridgestone	Radial	V	1422	3 mm
Rear Right	255/40R18	95Y	Bridgestone	Radial	V	3518	1 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA8E32030A554420



CONDITION REPORT



Report No:
2016960965
DATE
29/07/2025

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ZGM	801C20	ZGM: CENTRAL FAULT MEMORY FULL- NO CONTROL -UNIT FAULT	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Minor dents and scratches and stone chips to some body panels. Signs of repair work done to somebody panels. Poor alignment to somebody panels.

Undercarriage: excessive vibration from vehicle.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: WBA8E32030A554420




CONDITION REPORT




Report No:
2016960965
DATE
29/07/2025

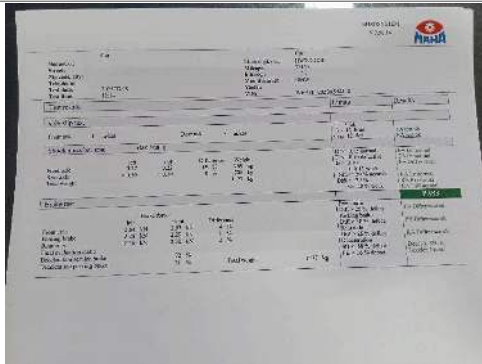

Brake and shock absorber

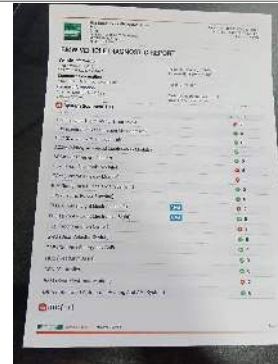

Diagnostic report

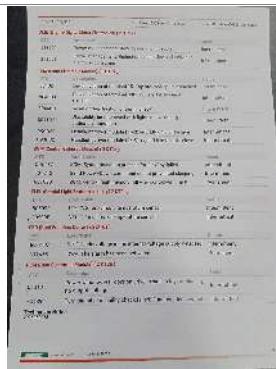

Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA8E32030A554420



CONDITION REPORT



Report No:
2016960965
DATE
29/07/2025



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



AUTOMATIC



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA8E32030A554420



CONDITION REPORT



Report No:
2016960965
DATE
29/07/2025



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA8E32030A554420



CONDITION REPORT



Report No:
2016960965
DATE
29/07/2025



VIN PLATE OR STICKER



ENGINE 1



ADDITIONAL 4



ADDITIONAL 5



ADDITIONAL 10



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA8E32030A554420



CONDITION REPORT



Report No:
2016960965
DATE
29/07/2025



Front Bumper



Front Bumper



Bonnet



Front Fender Left



Rear Fender Left



Door Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA8E32030A554420



CONDITION REPORT



Report No:
2016960965
DATE
29/07/2025



Door Rear Left



Rear bumper



Rear bumper



Boot Lid / Hatch door



Door Front Right



Door Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA8E32030A554420



CONDITION REPORT



Report No:
2016960965
DATE
29/07/2025



Front Fender Right



Rear Fender Right



Gearbox Mountings



Headlight Left



Engine mountings

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA8E32030A554420