



CONDITION REPORT



Report No:
2017302499
DATE
23/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	23/09/2026		M57 Pretoria Road - 1619
Inspection Date	23/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	MERCEDES-BENZ	Registration Number	KB55LVGP
Model	AMG CLA 45 4MATIC 7-SP AT [2013-2016]	Register Number	
VIN	WDD1173522N100841	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	
Color	WHITE	Power / Displacement	
Year Model	2014	Paint Finish	TWO COAT UNI
Km Reading	133,471 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: WDD1173522N100841



CONDITION REPORT



Report No:
2017302499
DATE
23/09/2026

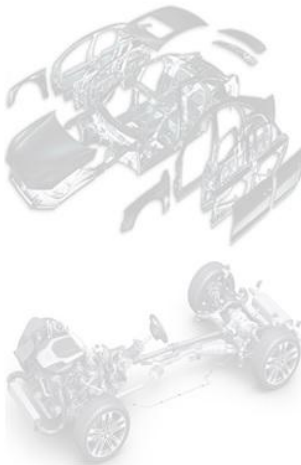

Damage	Repair Way
Engine Oil Leak	Repair
Engine Management Lights Set	Repair
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
Door Front Left Damaged	Repair
Door Rear Left Damaged	Repair
Rear bumper Damaged	Repair
Tyre Front Left Worn	Replace
Tyre Front Right Worn	Repair
Tyre Rear Left Worn	Replace
Tyre Rear Right Worn	Replace
Engine to silencer pipe Welded	Replace
Catalytic converter Missing	Repair
Gearbox Oil Leak	Repair
Engine Smoke Excessive	Repair

Brakes

Brake Test Results

No Brake Test on a brake test machine has been performed.

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	-	-	-	
Rear	-	-	-	
Emergency / Parking	-	-	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	235/35R19	91Y	Continental	Sport	V	4324	0 mm
Front Right	235/35R19	91Y	Continental	Sport	V	4324	0 mm
Rear Left	235/35R19	91W	Atlas	Radial	V	3620	0 mm
Rear Right	235/35R19	91W	Atlas	Radial	V	3620	0 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDD1173522N100841



CONDITION REPORT



Report No:
2017302499
DATE
23/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ECM	P008792	FUEL PRESSURE IN THE SYSTEM IS TOO LOW	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: 26 DTC'S AT TIME OF TESTING SEE DTC REPORT.ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.Engine Compartment: signs of aftermarket performance done to vehicle.

Body • Exterior: Minor dents and scratches and stone chips to body panels. Signs of repair work done to body panels. Poor alignment to somebody panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDD1173522N100841



CONDITION REPORT



Report No:

2017302499

DATE

23/09/2026



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE FRONT



90 DEGREE REAR



90 DEGREE LEFT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDD1173522N100841



CONDITION REPORT



Report No:

2017302499

DATE

23/09/2026



ODOMETER



DASHBOARD (W/ ENGINE RUNNING)



INTERIOR (FRONT DRIVER DOOR)



Automatic.



LR TYRE TREAD



RR TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDD1173522N100841



CONDITION REPORT



Report No:

2017302499

DATE

23/09/2026



RF TYRE TREAD



LF TYRE TREAD



Undercarriage front.



Undercarriage rear.



Oil cap and dipstick.



ENGINE 1

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDD1173522N100841



CONDITION REPORT



Report No:

2017302499

DATE


23/09/2026




VIN PLATE OR STICKER




LICENSE DISC

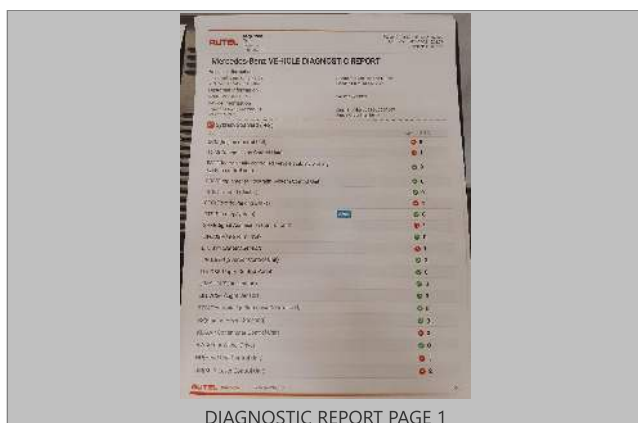


DIAGNOSTIC REPORT PAGE 1

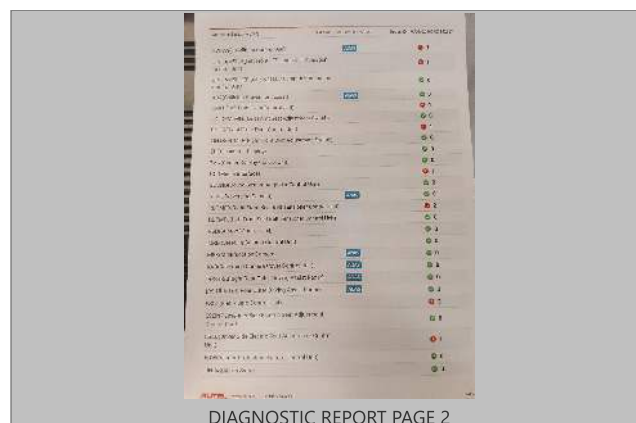

DIAGNOSTIC REPORT PAGE 2

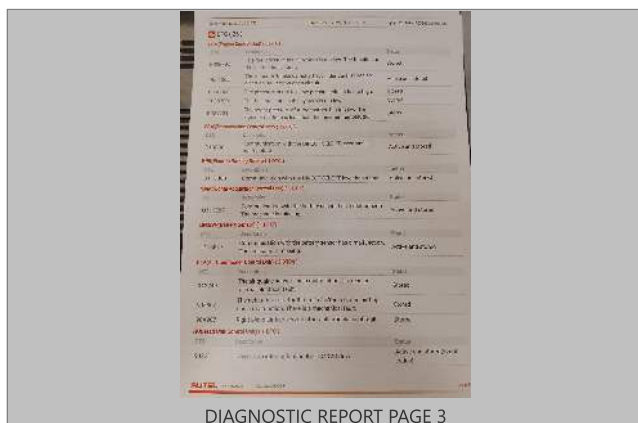

DIAGNOSTIC REPORT PAGE 3

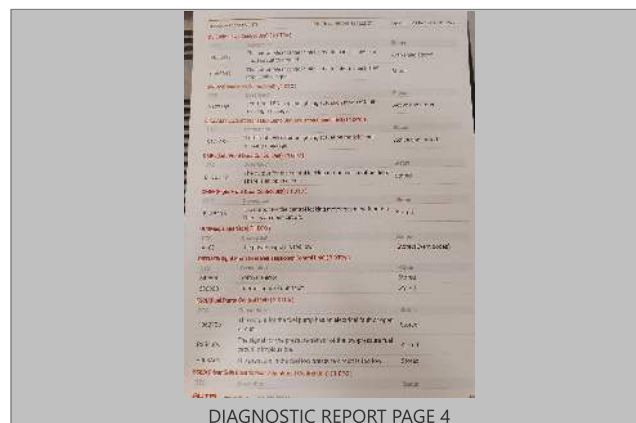

DIAGNOSTIC REPORT PAGE 4

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: WDD1173522N100841




CONDITION REPORT



Report No:
2017302499
DATE
23/09/2026

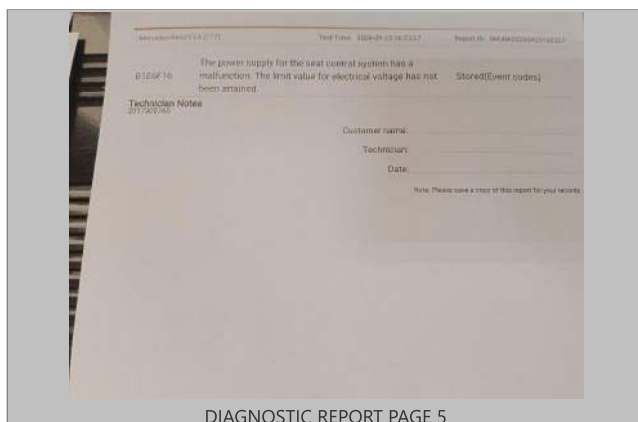


DIAGNOSTIC REPORT PAGE 5

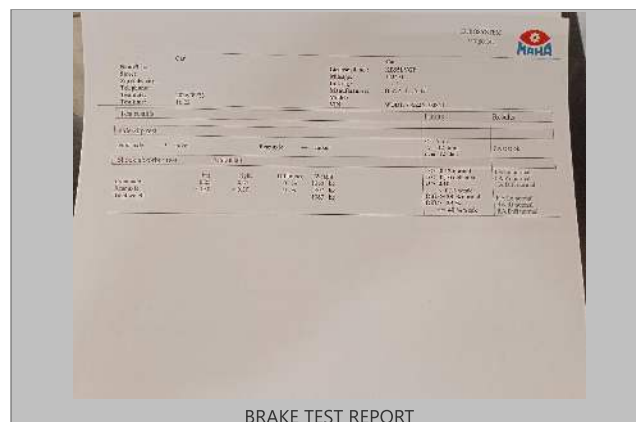


BRAKE TEST REPORT



Water level

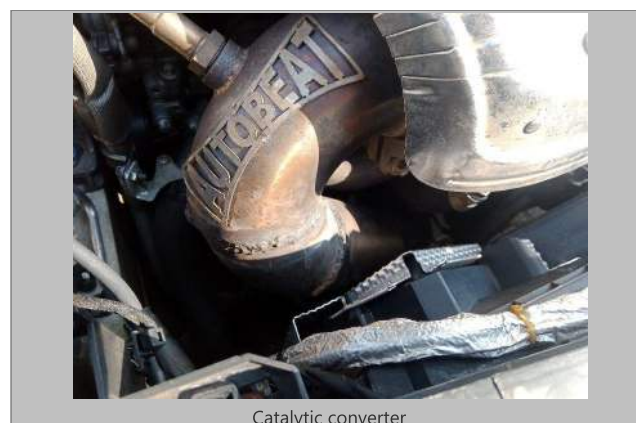

Catalytic converter

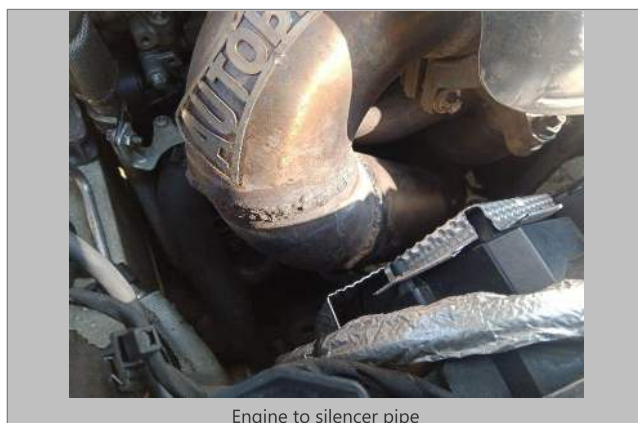

Engine to silencer pipe



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDD1173522N100841



CONDITION REPORT



Report No:
2017302499
DATE
23/09/2026



Front Bumper



Bonnet



Door Front Left



Door Rear Left



Rear bumper



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDD1173522N100841



CONDITION REPORT



Report No:

2017302499

DATE

23/09/2026



Engine Management Lights



Tyre Rear Left



Tyre Rear Right



Tyre Front Left



Tyre Front Right



Engine

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDD1173522N100841



CONDITION REPORT



Report No:
2017302499
DATE
23/09/2026



Gearbox

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDD1173522N100841