



## CONDITION REPORT



Report No:  
2016960393  
DATE  
28/07/2025

MFC Auction House  
M57 Pretoria Rd, Glenmarais, KEMPTON PARK  
Gauteng

DEKRA MFC  
M57 Pretoria Rd - 1619  
KEMPTON PARK - GT  
08610 33572



## Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	28/07/2025		M57 Pretoria Road - 1619
Inspection Date	28/07/2025		Kempton Park - GT

## Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	MERCEDES-BENZ	Registration Number	KSB920MP
Model	C180	Register Number	
VIN	WDD2050402R301411	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	31/10/2023
Color	SILVER	Power / Displacement	
Year Model		Paint Finish	TWO COAT METALLIC
Km Reading	144,159 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	AUTOMATIC

## Vehicle Options &amp; Accessories

## Items

## VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za


VIN: WDD2050402R301411



## CONDITION REPORT



Report No:  
2016960393  
DATE  
28/07/2025

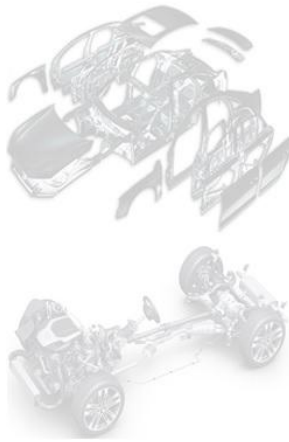**Damage****Repair Way**

Tail Light Right Damaged	Replace
Seat Front Right Damaged	Repair
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
Front Fender Right Damaged	Repair
Rear Fender Right Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Damaged	Repair
Door Rear Left Damaged	Repair
Door Rear Right Damaged	Repair
Rear bumper Damaged	Repair
Parking Brake Performance Left / Right Difference out of legal range	Repair

**Brakes****Brake Test Results**

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s <sup>2</sup> ]
Front	3.25	3.85	-	
Rear	2.51	2.65	-	
Emergency / Parking	1.21	0.41	-	

**Tyres and Rims****Tyre Specification & Measurement**

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	225/50R17	94W	Bridgestone	Radial	V	1422	2 mm
Front Right	225/50R17	94W	Bridgestone	Radial	V	2622	2 mm
Rear Left	225/50R17	94W	Bridgestone	Radial	V	2922	2 mm
Rear Right	225/50R17	94W	Bridgestone	Radial	V	1422	2 mm

\* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: WDD2050402R301411

**CONDITION REPORT**

Report No:  
2016960393  
DATE  
28/07/2025

**Diagnostic**

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

**Inspection Conditions**

No Test Drive  
Battery Flat  
Engine number – not possible to verify engine number (not visible without dismantling)  
Inspection conditions for the vehicle inspection were sufficient

**Comments**

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Minor dents and scratches and stone chips to some body panels. Signs of repair work done to somebody panels. Poor alignment to somebody panels.

**Concluding Remarks**

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

**Technician**

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: WDD2050402R301411




## CONDITION REPORT



**Report No:**  
**2016960393**  
**DATE**  
**28/07/2025**

[illegible]

Brake test.



The screenshot shows a Google search interface with the query "the most powerful vehicle engine in the world". The search results are displayed in a list format. The first result is from "topgear.com" and is titled "The most powerful car engine in the world". It includes a thumbnail image of a car and a brief description. The second result is from "topgear.com" and is titled "The most powerful car engine in the world". It also includes a thumbnail image of a car and a brief description. The third result is from "topgear.com" and is titled "The most powerful car engine in the world". It includes a thumbnail image of a car and a brief description. The fourth result is from "topgear.com" and is titled "The most powerful car engine in the world". It includes a thumbnail image of a car and a brief description. The fifth result is from "topgear.com" and is titled "The most powerful car engine in the world". It includes a thumbnail image of a car and a brief description. The sixth result is from "topgear.com" and is titled "The most powerful car engine in the world". It includes a thumbnail image of a car and a brief description. The seventh result is from "topgear.com" and is titled "The most powerful car engine in the world". It includes a thumbnail image of a car and a brief description. The eighth result is from "topgear.com" and is titled "The most powerful car engine in the world". It includes a thumbnail image of a car and a brief description. The ninth result is from "topgear.com" and is titled "The most powerful car engine in the world". It includes a thumbnail image of a car and a brief description. The tenth result is from "topgear.com" and is titled "The most powerful car engine in the world". It includes a thumbnail image of a car and a brief description.

Diagnostic.

[illegible]

Diagnostic.

English	Portuguese	Portuguese	English
1. <i>What is the difference between a noun and a verb?</i>			
2. <i>What is the difference between a noun and a verb?</i>			
3. <i>What is the difference between a noun and a verb?</i>			
4. <i>What is the difference between a noun and a verb?</i>			
5. <i>What is the difference between a noun and a verb?</i>			
6. <i>What is the difference between a noun and a verb?</i>			
7. <i>What is the difference between a noun and a verb?</i>			
8. <i>What is the difference between a noun and a verb?</i>			
9. <i>What is the difference between a noun and a verb?</i>			
10. <i>What is the difference between a noun and a verb?</i>			
11. <i>What is the difference between a noun and a verb?</i>			
12. <i>What is the difference between a noun and a verb?</i>			
13. <i>What is the difference between a noun and a verb?</i>			
14. <i>What is the difference between a noun and a verb?</i>			
15. <i>What is the difference between a noun and a verb?</i>			
16. <i>What is the difference between a noun and a verb?</i>			
17. <i>What is the difference between a noun and a verb?</i>			
18. <i>What is the difference between a noun and a verb?</i>			
19. <i>What is the difference between a noun and a verb?</i>			
20. <i>What is the difference between a noun and a verb?</i>			

Diagnostic.

Abkürzung	Abkürzung für die Bezeichnung	Abkürzung für die Bezeichnung	Abkürzung für die Bezeichnung
12-1	12-1	12-1	12-1
12-2	12-2	12-2	12-2
12-3	12-3	12-3	12-3
12-4	12-4	12-4	12-4
12-5	12-5	12-5	12-5
12-6	12-6	12-6	12-6
12-7	12-7	12-7	12-7
12-8	12-8	12-8	12-8
12-9	12-9	12-9	12-9
12-10	12-10	12-10	12-10
12-11	12-11	12-11	12-11
12-12	12-12	12-12	12-12
12-13	12-13	12-13	12-13
12-14	12-14	12-14	12-14
12-15	12-15	12-15	12-15
12-16	12-16	12-16	12-16
12-17	12-17	12-17	12-17
12-18	12-18	12-18	12-18
12-19	12-19	12-19	12-19
12-20	12-20	12-20	12-20
12-21	12-21	12-21	12-21
12-22	12-22	12-22	12-22
12-23	12-23	12-23	12-23
12-24	12-24	12-24	12-24
12-25	12-25	12-25	12-25
12-26	12-26	12-26	12-26
12-27	12-27	12-27	12-27
12-28	12-28	12-28	12-28
12-29	12-29	12-29	12-29
12-30	12-30	12-30	12-30
12-31	12-31	12-31	12-31
12-32	12-32	12-32	12-32
12-33	12-33	12-33	12-33
12-34	12-34	12-34	12-34
12-35	12-35	12-35	12-35
12-36	12-36	12-36	12-36
12-37	12-37	12-37	12-37
12-38	12-38	12-38	12-38
12-39	12-39	12-39	12-39
12-40	12-40	12-40	12-40
12-41	12-41	12-41	12-41
12-42	12-42	12-42	12-42
12-43	12-43	12-43	12-43
12-44	12-44	12-44	12-44
12-45	12-45	12-45	12-45
12-46	12-46	12-46	12-46
12-47	12-47	12-47	12-47
12-48	12-48	12-48	12-48
12-49	12-49	12-49	12-49
12-50	12-50	12-50	12-50
12-51	12-51	12-51	12-51
12-52	12-52	12-52	12-52
12-53	12-53	12-53	12-53
12-54	12-54	12-54	12-54
12-55	12-55	12-55	12-55
12-56	12-56	12-56	12-56
12-57	12-57	12-57	12-57
12-58	12-58	12-58	12-58
12-59	12-59	12-59	12-59
12-60	12-60	12-60	12-60
12-61	12-61	12-61	12-61
12-62	12-62	12-62	12-62
12-63	12-63	12-63	12-63
12-64	12-64	12-64	12-64
12-65	12-65	12-65	12-65
12-66	12-66	12-66	12-66
12-67	12-67	12-67	12-67
12-68	12-68	12-68	12-68
12-69	12-69	12-69	12-69
12-70	12-70	12-70	12-70
12-71	12-71	12-71	12-71
12-72	12-72	12-72	12-72
12-73	12-73	12-73	12-73
12-74	12-74	12-74	12-74
12-75	12-75	12-75	12-75
12-76	12-76	12-76	12-76
12-77	12-77	12-77	12-77
12-78	12-78	12-78	12-78
12-79	12-79	12-79	12-79
12-80	12-80	12-80	12-80
12-81	12-81	12-81	12-81
12-82	12-82	12-82	12-82
12-83	12-83	12-83	12-83
12-84	12-84	12-84	12-84
12-85	12-85	12-85	12-85
12-86	12-86	12-86	12-86
12-87	12-87	12-87	12-87
12-88	12-88	12-88	12-88
12-89	12-89	12-89	12-89
12-90	12-90	12-90	12-90
12-91	12-91	12-91	12-91
12-92	12-92	12-92	12-92
12-93	12-93	12-93	12-93
12-94	12-94	12-94	12-94
12-95	12-95	12-95	12-95
12-96	12-96	12-96	12-96
12-97	12-97	12-97	12-97
12-98	12-98	12-98	12-98
12-99	12-99	12-99	12-99
13-00	13-00		

Diagnostic.

[illegible]

Diagnostic.

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)


VIN: WDD2050402R301411



## CONDITION REPORT



Report No:  
2016960393  
DATE  
28/07/2025

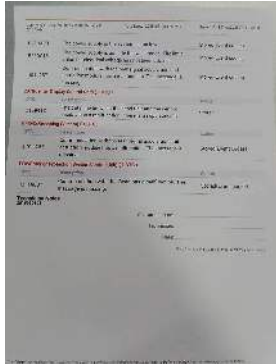

Diagnostic.



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: WDD2050402R301411





## CONDITION REPORT



Report No:  
2016960393  
DATE  
28/07/2025



Automatic.



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: WDD2050402R301411



## CONDITION REPORT



Report No:  
2016960393  
DATE  
28/07/2025



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: WDD2050402R301411





## CONDITION REPORT



Report No:  
2016960393  
DATE  
28/07/2025



Undercarriage front.



Undercarriage rear.



Oil cap and dipstick.



Water level



Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: WDD2050402R301411





## CONDITION REPORT



Report No:  
2016960393  
DATE  
28/07/2025



Bonnet



Door Front Left



Door Rear Left



Rear bumper



Rear Fender Right



Door Front Right

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: WDD2050402R301411



## CONDITION REPORT



Report No:  
2016960393  
DATE  
28/07/2025



Door Rear Right



Front Fender Right



Tail Light Right



Seat Front Right

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: WDD2050402R301411