



CONDITION REPORT

Report No: 2016357219

DATE
26/04/2024

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	26/04/2024		M57 Pretoria Road - 1619
Inspection Date	26/04/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	FORD	Registration Number	FML864L
Model	FOCUS	Register Number	
VIN	WF05XXGCC5GT66367	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/12/2023
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	TWO COAT UNI
Km Reading	154,449 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Engine Oil Sweat	Repair
Battery box Defective	Repair
Headlight Left Defective	Repair
Headlight Right Defective	Repair
Seat Front Left Dirty	Repair
Seat Front Right Damaged	Repair
Seat Rear Dirty	Repair
Steering Wheel Trim Worn	Repair
Front Bumper Paintwork • Scratched	Repair
Front Fender Left Residual Traces of Repair	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Paintwork • Chipmarks	Repair
Door Rear Right Paintwork • Scratched	Replace
Rear bumper Paintwork • Scratched	Repair
Windscreen Chipped	Repair
Rim Front Left Dented	Repair
Rim Front Right Scratched	Repair
Rim Rear Left Scratched	Repair
Rim Rear Right Scratched	Repair
Sub Frame Scratched	Repair
Engine mountings Defective	Repair
Belly plates Damaged	Replace
Gearbox Mountings Broken	Replace
Gearbox Oil Sweat	Repair
CV Joint(s) Boot(s) Front Left (inner/outer) Defective	Replace
Jack Missing	Replace
Wheel Spanner Missing	Replace
Triangle Missing	Replace
Engine	Engine bay dirty

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF05XXGCC5GT66367

1 / 13



CONDITION REPORT

Report No: 2016357219

DATE
26/04/2024

Damage	Repair Way
Engine	Front exhaust heat shield loose
Electrical instruments and components	Boot release switch damaged
Undercarriage	Vehicle undercarriage dirty
Interior	Vehicle interior dirty and some panels scratched
Body and Exterior	Dents and scratches on some body panels
Body and Exterior	Stone chips and spray work on some body panels

Brakes

Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	3.61	3.16	-	
Rear	2.33	2.37	-	
Emergency / Parking	1.65	1.75	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	215/50 R17	95Y	General	Altimax	V	3621	6 mm
Front Right	215/50 R17	95Y	General	Altimax	V	3721	5 mm
Rear Left	215/50 R17	95Y	General	Altimax	V	4321	5 mm
Rear Right	215/50 R17	95Y	General	Altimax	V	3621	6 mm
Spare	T125/90 R16	98M	Hankook	Temporary	V	2616	3 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	PCM(POWERTRAIN CONTROL MODULE)	P0299:0-68	TURBOCHARGER/SUPERCHARGER A UNDER BOOST CONDITION	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase


This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.


DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za




CONDITION REPORT

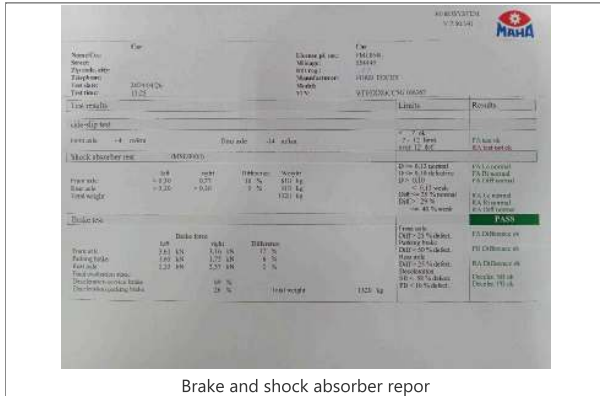


Brake and shock absorber repor

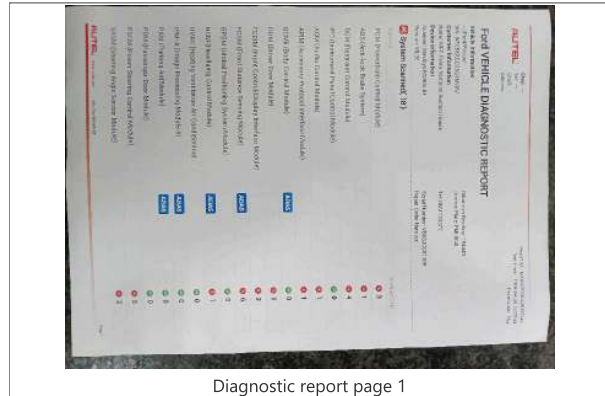

Diagnostic report page 1

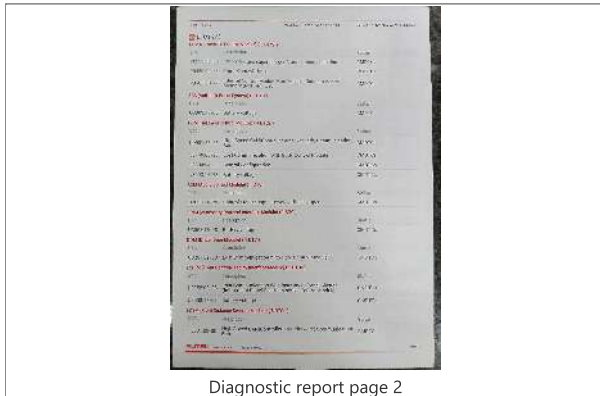

Diagnostic report page 2

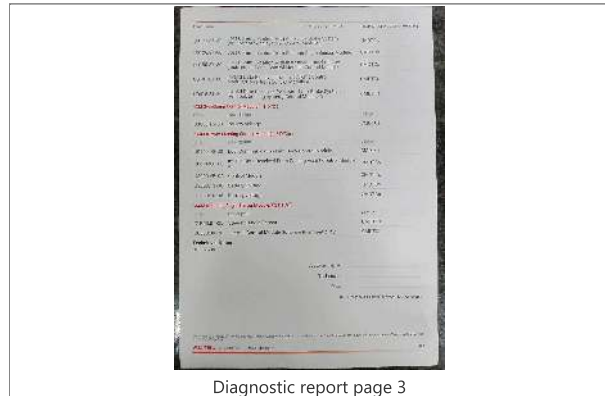

Diagnostic report page 3



FRONT RIGHT CORNER



REAR LEFT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016357219

VIN: WF05XXGCC5GT66367

DATE

26/04/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016357219

DATE: 26/04/2024
VIN: WF05XXGC650192824
4 / 13



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual transmission



90 DEGREE FRONT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016357219

DATE
26/04/2024

VIN: WF05XXGCC5GT66367

5 / 13

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016357219

DATE
26/04/2024

VIN: WF05XXGCC5GT66367

6 / 13



90 DEGREE REAR



90 DEGREE LEFT




LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD

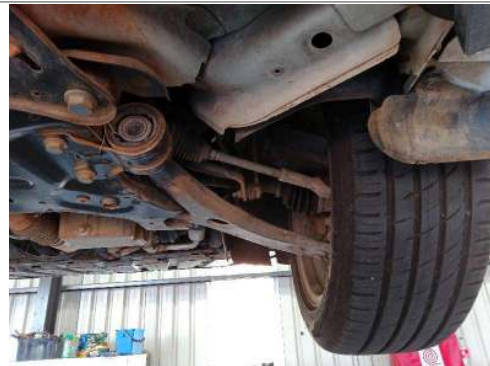

RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016357219

DATE
26/04/2024

VIN: WF05XXGCC5GT66367

7 / 13

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016357219

DATE
26/04/2024

C5GT66367
8 / 13



Spare wheel



LICENSE DISC




VIN PLATE OR STICKER



ENGINE 1



Front chassis

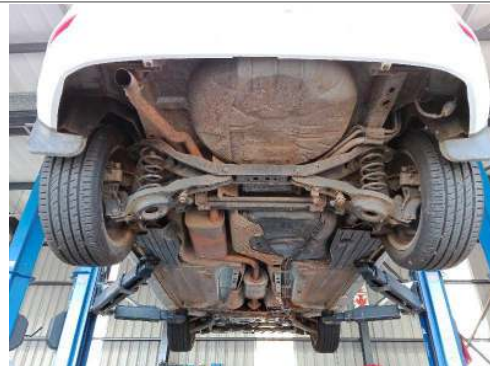

Rear chassis

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016357219

DATE
26/04/2024

VIN: WF05XXGCC5GT66367

9 / 13

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016357219

DATE
26/04/2024



Oil cap and dipstick



Front exhaust heat shield

VIN: XSGGCC5GT66367
10 / 13



Boot release switch



Water level



Water level



Engine

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016357219

DATE
26/04/2024

VIN: WF05XXGCC5GT66367

11 / 13

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016357219

DATE
26/04/2024



Steering Wheel Trim



Seat Front Right

Vehicle VIN: WFD0XCC5GT66367
12 / 13



Door Front Right



Door Rear Right



Seat Rear



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016357219

DATE
26/04/2024

VIN: WF05XXGCC5GT66367
13 / 13

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016357219

DATE
26/04/2024



Rear bumper



Door Rear Left



Seat Rear



Seat Front Left



Windscreen



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016357219

DATE
26/04/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016357219

DATE
26/04/2024



Front Bumper



Headlight Left



Headlight Right



Rim Front Right



Rim Rear Right



Rim Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016357219

DATE
26/04/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016357219

DATE
26/04/2024



Front Fender Left



Belly plates



Rim Front Left



Engine



Sub Frame



CV Joint(s) Boot(s) Front Left (inner/outer)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016357219

DATE
26/04/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016357219

DATE
26/04/2024



Gearbox



Gearbox Mountings



Engine mountings



Battery box

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016357219

DATE
26/04/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za