



CONDITION REPORT



Report No:
2016965732
DATE
01/08/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	01/08/2025		M57 Pretoria Road - 1619
Inspection Date	01/08/2025		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	FORD	Registration Number	FZ59NGGP
Model	FIESTA 1.0 ECOBOOST TREND ESP 5-DR [2016-2018]	Register Number	
		Date Of First Licensing	
VIN	WF0DXXGAKDHM74189	Last COR	
Engine Number		License Expiry Date	31/12/2025
Doors	5	Power / Displacement	
Color	WHITE	Paint Finish	C - COMMON
Year Model	2017	Fuel	PETROL
Km Reading	82,859 KM	Transmission	MANUAL
Cab / Body Type	HATCHBACK		

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0DXXGAKDHM74189



CONDITION REPORT



Report No:
2016965732
DATE
01/08/2025

	Damage	Repair Way
	Battery clamps Defective	Repair
	Windscreen Wiper Worn	Replace
	Windscreen Washer Defective	Repair
	Fog Light Front Left Missing	Replace
	Headlight Left Broken	Replace
	Seat Rear Torn / Cut	Repair
	Steering Wheel Trim Damaged	Replace
	Front Bumper Damaged	Replace
	Bonnet Residual Traces of Repair	Repair
	B • Pillar Right Residual Traces of Repair	Repair
	Front Fender Left Damaged	Repair
	Front Fender Right Paintwork • Scratched	Repair
	Rear Fender Left Dented	Repair
	Door Front Left Paintwork • Scratched	Repair
	Door Front Right Dented	Repair
	Rear bumper Paintwork • Scratched	Repair
	Sill Panel Left Dented	Repair
	Sill Panel Right Paintwork • Scratched	Repair
	Brake disc 1. Axle left Excessive Wear & Tear	Replace
	Brake disc 1. Axle right Excessive Wear & Tear	Replace
	Shock Absorber Front Left Worn	Replace
	Tyre Front Left Damaged	Replace
	Tyre Front Right Smooth	Replace
	Tyre Rear Left Smooth	Replace
	Rim Front Left Damaged	Repair
	Rim Front Right Scratched	Replace
	Gearbox Mountings Broken	Replace
	CV Joint(s) Boot(s) Front Left (inner/outer) Defective	Replace
	Steering Noisy	Repair
	Left stabilizer link leaking grease	Repace
	Rear coil spring mounting rubbers worn	Replace
	Spare wheel missing	Replace
	Excessive noise from front and rear suspension	Repair.

Brakes
Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s²]
	Braking Force [KN]	Braking Force [KN]		
Front	2.2	2.3	-	
Rear	1.4	1.3	-	
Emergency / Parking	1.1	1.2	-	

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0DXXGAKDHM74189



CONDITION REPORT



Report No:
2016965732
DATE
01/08/2025

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/60R15	84H	GT Radial	Champion	V	1621	0 mm
Front Right	185/60R15	84H	Continental	Contiprem	V	0421	0 mm
Rear Left	195/50R15	82V	Symmetry	SY201	V	0000	0 mm
Rear Right	185/60R15	84H	GT Radial	Champion	V	1621	3 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	PCM	P0562:1C-28	SYSTEM VOLTAGE LOW	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.Engine Compartment: Battery not secured.
Body • Exterior: Minor dents, scratches and chip marks on various body panels. Residual traces of previous paint repairs on some body panels. Poor alignment of some body panels.
Road Test: Excessive knocking noise heard when shaking the steering.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Clive Russon

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: WF0DXXGAKDHM74189




CONDITION REPORT



Report No:
2016965732
DATE
01/08/2025

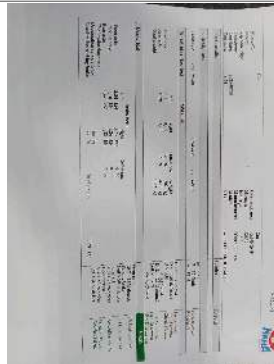


Brake test report

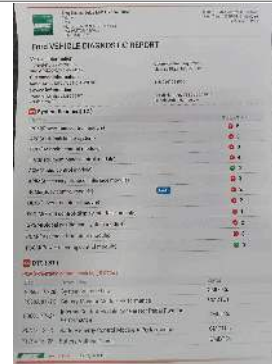

Diagnostic report



Diagnostic report

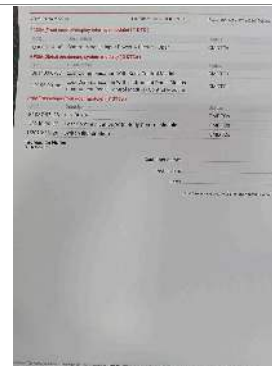

Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0DXXGAKDHM74189



CONDITION REPORT



Report No:
2016965732
DATE
01/08/2025



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual transmission



90 DEGREE FRONT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0DXXGAKDHM74189



CONDITION REPORT



Report No:
2016965732
DATE
01/08/2025



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0DXXGAKDHM74189



CONDITION REPORT



Report No:
2016965732
DATE
01/08/2025



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0DXXGAKDHM74189



CONDITION REPORT



Report No:
2016965732
DATE
01/08/2025



Left stabilizer link leaking g



L coil spring mounting rubbers



R coil spring mounting rubbers



Spare wheel missing



Oil cap and dipstick



Expansion bottle

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0DXXGAKDHM74189



CONDITION REPORT



Report No:
2016965732
DATE
01/08/2025



Headlight Left



Fog Light Front Left



Front Bumper



Front Bumper



Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0DXXGAKDHM74189



CONDITION REPORT




Report No:
2016965732
DATE
01/08/2025



Front Fender Left



Front Fender Left

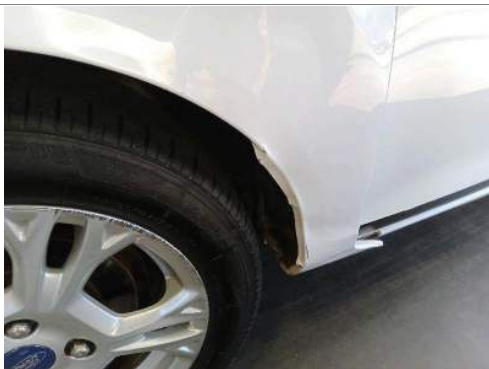

Front Fender Left



Door Front Left



Sill Panel Left



Rear Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0DXXGAKDHM74189



CONDITION REPORT




Report No:
2016965732
DATE
01/08/2025



Rear bumper



Rear bumper

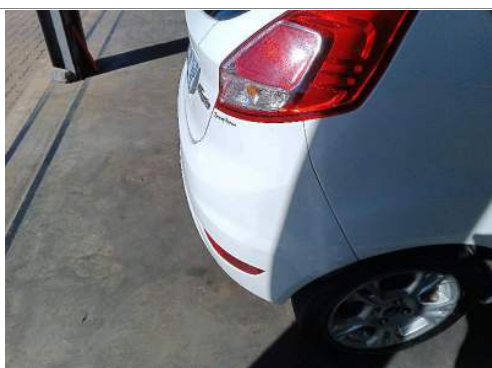

Rear bumper



Door Front Right



Front Fender Right



Bonnet

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0DXXGAKDHM74189



CONDITION REPORT



Report No:
2016965732
DATE
01/08/2025



Brake disc 1. Axle right



Rim Front Right



Rim Front Left



Rim Front Left



Rim Front Left



Brake disc 1. Axle left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0DXXGAKDHM74189



CONDITION REPORT



Report No:
2016965732
DATE
01/08/2025



Tyre Front Left



Sill Panel Right



Tyre Rear Left



Tyre Front Right



Tyre Front Left



Windscreen Washer

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0DXXGAKDHM74189



CONDITION REPORT



Report No:
2016965732
DATE
01/08/2025




Windscreen Washer



Gearbox Mountings



CV Joint(s) Boot(s) Front Left (inner/outer)

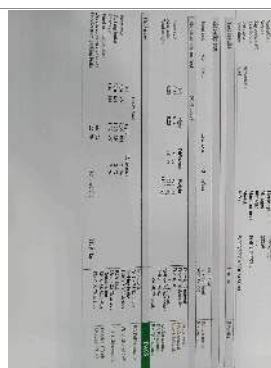

Shock Absorber Front Left



B • Pillar Right



Windscreen Wiper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0DXXGAKDHM74189



CONDITION REPORT



Report No:
2016965732
DATE
01/08/2025



Headlight Left



Battery clamps



Steering Wheel Trim



Seat Rear

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0DXXGAKDHM74189