



CONDITION REPORT

Report No: 2016593338

DATE  
31/10/2024

MFC Auction House  
M57 Pretoria Rd, Glenmarais, KEMPTON PARK  
Gauteng

DEKRA MFC  
M57 Pretoria Rd - 1619  
KEMPTON PARK - GT  
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	31/10/2024		M57 Pretoria Road - 1619
Inspection Date	31/10/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	FORD	Registration Number	FDK267FS
Model	FIESTA 1.4 AMBIENTE 5-DR [2010-2012]	Register Number	
VIN	WFOJXXGAJJCG35509	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/08/2020
Color	RED	Power / Displacement	
Year Model	2012	Paint Finish	M - METALLIC
Km Reading	177,340 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Fog Light Rear Left Missing	Replace
Seat Front Right Torn / Cut	Repair
Front Bumper Paintwork • Scratched	Repair
Bonnet Paintwork • Chipmarks	Repair
C • Pillar Left Damaged	Repair
Front Fender Left Residual Traces of Repair	Repair
Front Fender Right Paintwork • Scratched	Repair
Rear Fender Left Residual Traces of Repair	Repair
Rear Fender Right Residual Traces of Repair	Repair
Rear Fender Left / Inner Tray Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Damaged	Repair
Boot Lid / Hatch door Residual Traces of Repair	Repair
Rear bumper Residual Traces of Repair	Repair
Sill Panel Right Dented	Repair
Rear Axle Corrosion	Repair
Tyre Rear Left Smooth	Replace
Rim Front Right Cracked	Repair
Rim Rear Left Welded	Repair
Rim Rear Right Dented	Repair
Bolt(s) / Nut(s) Front Wheel Left Incorrect	Replace
Gearbox Mountings Cracked	Replace
Gearbox Oil Leak	Repair

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: WFOJXXGAJJCG35509

1 / 15



## CONDITION REPORT

Report No: 2016593338

DATE  
31/10/2024

### Brakes

#### Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s <sup>2</sup> ]
	Braking Force [KN]	Braking Force [KN]		
Front	2.9	3.0	-	
Rear	1.6	1.6	-	
Emergency / Parking	1.1	1.3	-	

### Tyres and Rims

#### Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195/50R15	82V	Nexen	Nblue	V	5019	2 mm
Front Right	195/50R15	82V	Goodyear	Efficient	V	2620	5 mm
Rear Left	195/50R15	82V	Dunlop	Sport	V	0617	0 mm
Rear Right	195/50R15	82V	Fullrun	Frun one	V	0120	1 mm

\* Tyre Legend: V=Virgin, R=Recap

### Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	POWERTRAIN CONTROL MODULE	P0504.00-28	BRAKE SWITCH A/B CORRELATION	

### Inspection Conditions

No Test Drive  
 Vehicle doesn't start  
 Battery Flat  
 Engine number – not possible to verify engine number (not visible without dismantling)  
 Inspection conditions for the vehicle inspection were sufficient

### Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Signs of spray work done on some body panels. Residual traces of repair work done on most body panels. Minor dents scratches and stone chips on some body panels.  
 Axle and Suspension: Both front control arm bushes covered.

### Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

### Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



CONDITION REPORT


VIN: WF0QXXGAJCG35509

Report No: 2016593338


2 / 15

DATE


31/10/2024

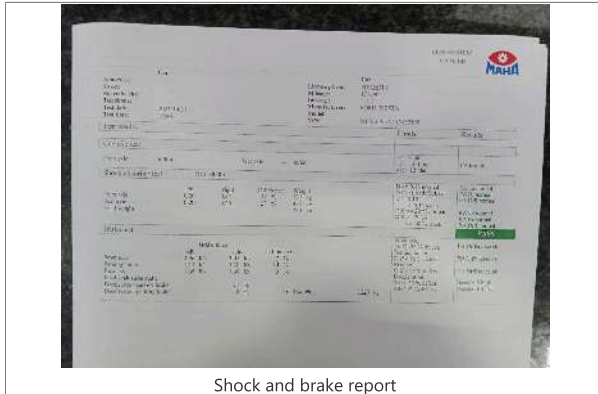


Shock and brake report

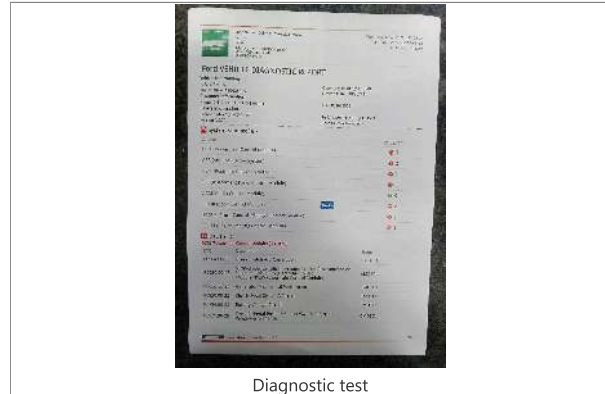

Diagnostic test

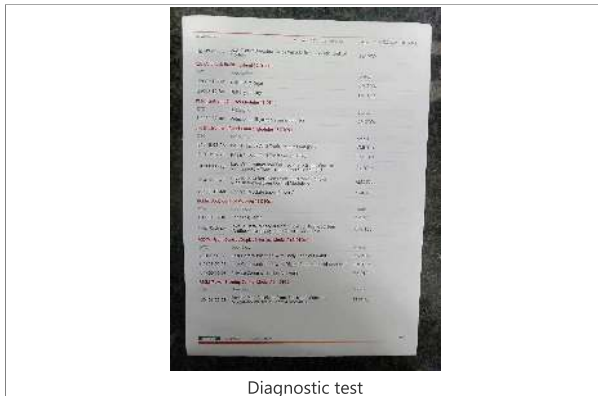

Diagnostic test

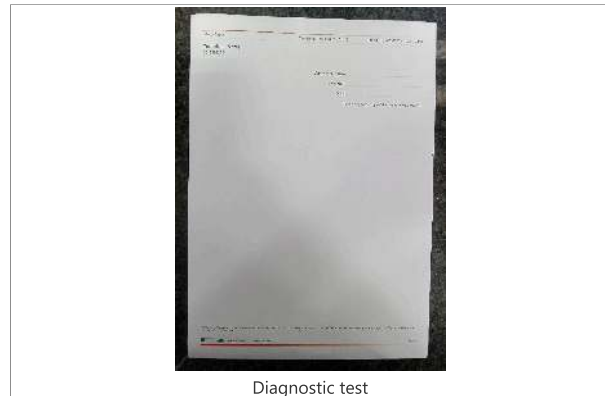

Diagnostic test



FRONT RIGHT CORNER



REAR LEFT CORNER

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016593338

VIN: WFOJXXGAJJCG35509

DATE  
31/10/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016593338

VIN: WFOJXXGAJCG35509  
DATE: 31/10/2024  
4/15



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual



90 DEGREE FRONT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016593338

DATE  
31/10/2024

VIN: WF0JXXGAJJCG35509

5 / 15

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za





CONDITION REPORT

Report No: 2016593338

DATE  
31/10/2024

VIN: WF0JXXGAJCG35509

6 / 15




90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD

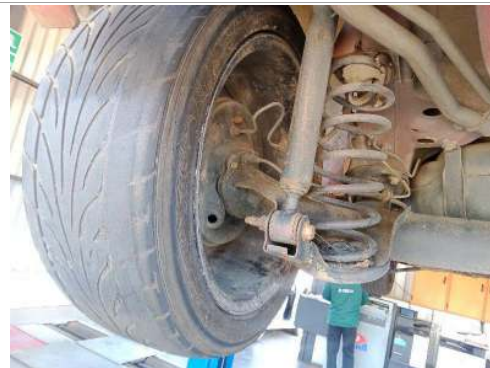

LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016593338

DATE  
31/10/2024

VIN: WF0JXXGAJJCG35509

7 / 15

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za





CONDITION REPORT

Report No: 2016593338

DATE  
31/10/2024



No sparewheel



LICENSE DISC

VIN-WF0JXXGAJCG35509  
8 / 15



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016593338

DATE  
31/10/2024

VIN: WF0JXXGAJCG35509

9 / 15

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016593338

DATE  
31/10/2024



Rear end



Expansion bottle


F0JXXGAJJCG35509  
10 / 15



L/R fender liner missing



Oil cap and dipstick

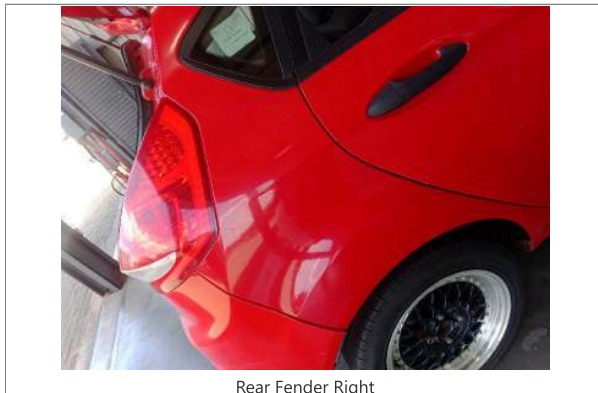

Rear Fender Right



Boot Lid / Hatch door

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016593338

DATE  
31/10/2024

VIN: WFOJXXGAJJCG35509

11 / 15

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za







CONDITION REPORT

Report No: 2016593338

DATE  
31/10/2024

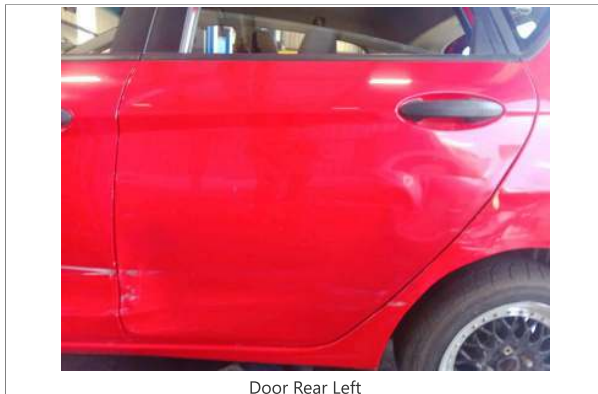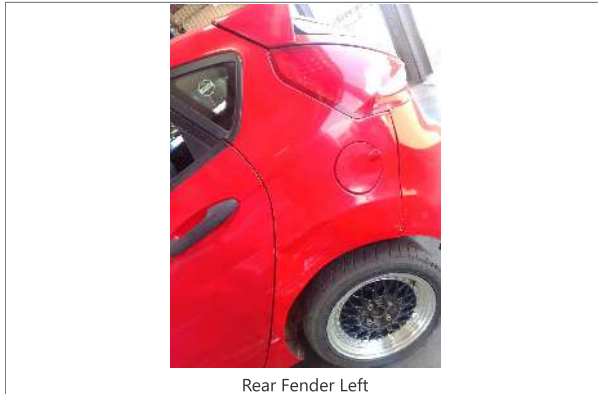

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za





CONDITION REPORT

Report No: 2016593338

DATE  
31/10/2024

VIN: WFOJXXGAJJCG35509

13 / 15

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016593338

DATE  
31/10/2024



Front Fender Left



Water level

VIN: WFOJXXGAJCG35509  
14 / 15



Door Front Right



Front Fender Right



Rim Front Right



Rim Front Right

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016593338

DATE  
31/10/2024

VIN: WF0JXXGAJCG35509

15 / 15

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za




CONDITION REPORT

Report No: 2016593338


DATE  
31/10/2024




Front Bumper

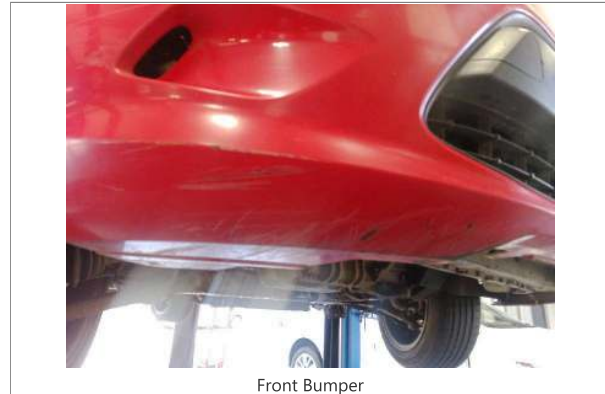

Front Bumper

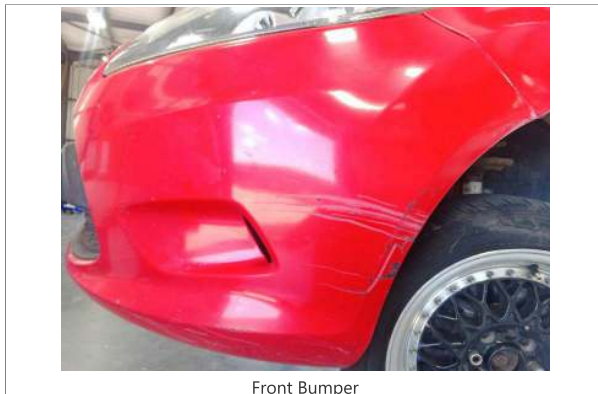

Front Bumper

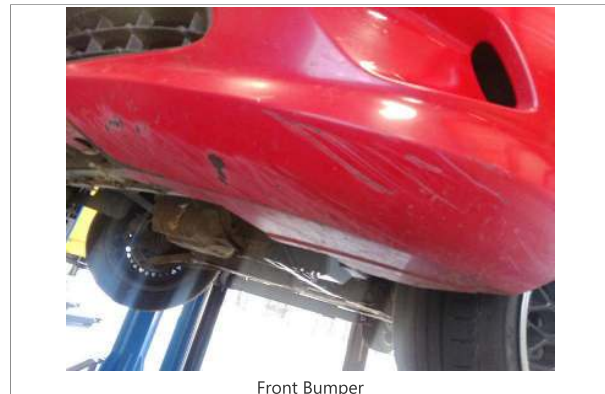

Front Bumper



Front Bumper



Bolt(s) / Nut(s) Front Wheel Left

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016593338

DATE  
31/10/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za






CONDITION REPORT

Report No: 2016593338


DATE  
31/10/2024

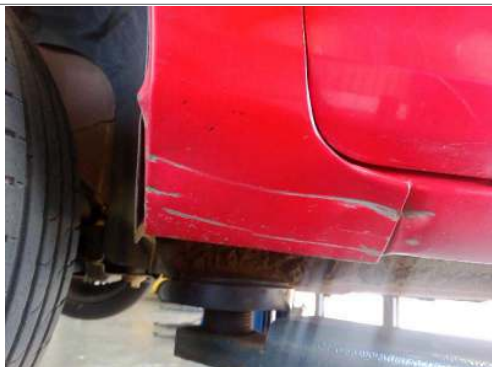

Front Fender Left



Door Front Left

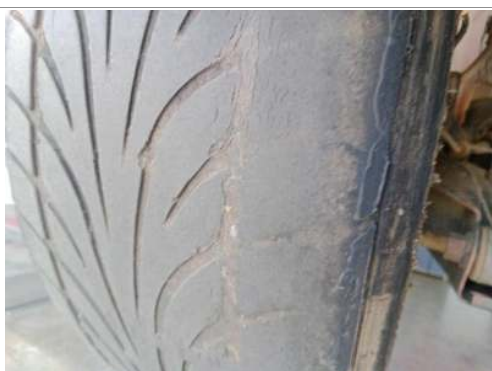

Tyre Rear Left



Rear Fender Left



Rear bumper



Rear bumper

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016593338

DATE  
31/10/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016593338

DATE  
31/10/2024



Rear bumper



Fog Light Rear Left



Rim Front Right



Gearbox Mountings



Gearbox



Gearbox

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016593338

DATE  
31/10/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za





CONDITION REPORT

Report No: 2016593338

DATE  
31/10/2024




Gearbox



Gearbox



Rear Axle

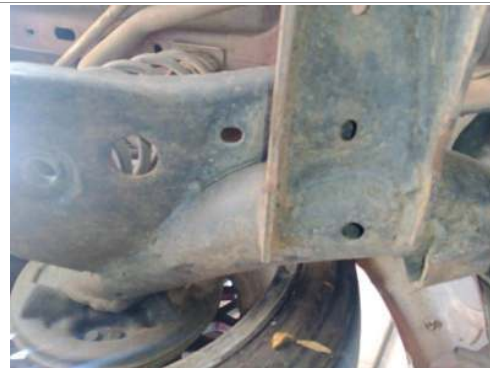

Rear Axle



Rim Rear Left



Rim Rear Right

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za





CONDITION REPORT

Report No: 2016593338

DATE  
31/10/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016593338

DATE  
31/10/2024



Rear Fender Left / Inner Tray



Sill Panel Right



Sill Panel Right



Bonnet



Bonnet



Seat Front Right

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



**CONDITION REPORT**

**Report No: 2016593338**

**DATE**  
**31/10/2024**

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za