



CONDITION REPORT



Report No:
2017305006
DATE
30/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	30/09/2026		M57 Pretoria Road - 1619
Inspection Date	30/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	MINI	Registration Number	FY38GJGP
Model	COOPER COUNTRYMAN 1.5 STEPTRONIC [2017-2020]	Register Number	
VIN	WMWYS320103C00315	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	28/02/2026
Color	BLUE	Power / Displacement	
Year Model	2017	Paint Finish	M - METALLIC
Km Reading	153,033 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WMWYS320103C00315



CONDITION REPORT



Report No:

2017305006

DATE

30/09/2026

Damage

Repair Way

Front Bumper Paintwork • Scratched	Repair
Bonnet Paintwork • Scratched	Repair
Rear Fender Right Paintwork • Scratched	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Paintwork • Scratched	Repair
Windscreen Cracked	Replace
Tyre Rear Right Smooth	Replace
Gearbox malfunction it only select reverse gear	Repair
Rear tyres size differs	Replace



Brakes

Brake Test Results

No Brake Test on a brake test machine has been performed.

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	-	-	-	
Rear	-	-	-	
Emergency / Parking	-	-	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	225/50R17	98Y	Radarr	Dimax	V	2224	3 mm
Front Right	225/50R17	98Y	Radarr	Dimax	V	2723	3 mm
Rear Left	225/55R17	101W	Hilo	Vantage	V	1121	3 mm
Rear Right	225/50R17	94W	Continental	Contact	V	0520	0 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WMWYS320103C00315



CONDITION REPORT



Report No:
2017305006
DATE
30/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	INTERMITTENT	213501	POWER MANAGEMENT: TOTAL DISCHARGE	

Inspection Conditions

No Test Drive
Rain at time of inspection
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. NO BRAKE TEST DONE DUE TO GEARBOX MALFUNCTION.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WMWYS320103C00315



CONDITION REPORT



Report No:

2017305006

DATE


30/09/2026



Diagnostic report



Diagnostic report

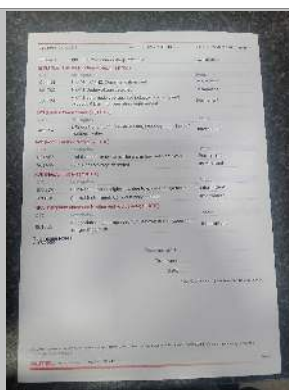

Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WMWYS320103C00315



CONDITION REPORT



Report No:

2017305006

DATE

30/09/2026



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: WMWYS320103C00315



CONDITION REPORT



Report No:

2017305006

DATE

30/09/2026



90 DEGREE LEFT




LF TYRE TREAD



RR TYRE TREAD



LR TYRE TREAD

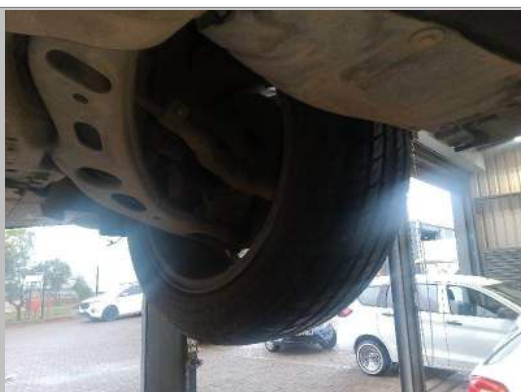

RF TYRE TREAD



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: WMWYS320103C00315



CONDITION REPORT



Report No:
2017305006
DATE
30/09/2026



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



No spare wheel



Expenditure bottle

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WMWYS320103C00315



CONDITION REPORT



Report No:
2017305006
DATE
30/09/2026



Oil cap



Water level



Bonnet



Door Rear Left



Door Front Left



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WMWYS320103C00315



CONDITION REPORT



Report No:
2017305006
DATE
30/09/2026



Front Bumper



Door Front Right



Door Rear Right



Rear Fender Right



Tyre Rear Right



Windscreen

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WMWYS320103C00315



CONDITION REPORT



Report No:
2017305006
DATE
30/09/2026



Bonnet

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WMWYS320103C00315