



CONDITION REPORT

Report No: 2016376766

DATE
13/05/2024

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572

**Assignment**

Client	MFC Auction House	Inspection Location	MFC
Requested Date	13/05/2024		M57 Pretoria Road - 1619
Inspection Date	13/05/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	MINI	Registration Number	KN10MXGP
Model	COOPER S COUNTRYMAN	Register Number	
VIN	WMWZC32020WN04475	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/03/2025
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	C - COMMON
Km Reading	168,496 KM	Fuel	PETROL
Cab / Body Type	STATION WAGON	Transmission	MANUAL

Vehicle Options & Accessories**Items**

VEHICLE INSPECTION



Damage	Repair Way
Engine Oil Leak	Repair
Fog Light Front Left Cracked	Replace
Fog Light Front Right Cracked	Replace
Front Bumper Cracked	Repair
Rear Fender Right Residual Traces of Repair	Repair
Rear bumper Cracked	Repair
Rim Front Left Damaged	Repair
Rim Rear Left Scratched	Repair
Tyre Front Left Smooth	Replace
Gearbox Oil Leak	Repair
Engine Noise Excessive	Repair
Body exterior	Signs of spray work done on some body panels
Body exterior	Minor dents scratches and stone chips on some body
Tyre pressure warning lights illuminated	Repair.
Foreign substance on oil cap see additional 10	Repair.



CONDITION REPORT

Report No: 2016376766

DATE
13/05/2024

Brakes

Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	3.2	3.3	-	-
Rear	2.7	3.5	-	-
Emergency / Parking	1.9	2.4	-	-

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	225/45R18	91V	Bridgestone	Dueler	V	4915	0 mm
Front Right	225/45R18	91W	Kumho	Ecsta	V	1716	4 mm
Rear Left	225/45R18	91W	Bridgestone	Turanza	V	2022	6 mm
Rear Right	225/45R18	91W	Bridgestone	Turanza	V	4021	6 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. RESIDUAL TRACES OF REPAIR WORK DONE ON SOME BODY PANELS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.




CONDITION REPORT


Report No: 2016376766

DATE
13/05/2024


Shock and brake report

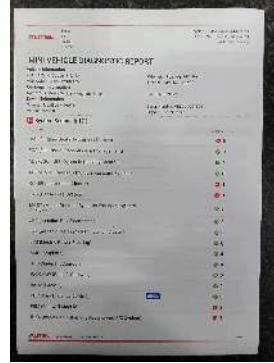

Diagnostic test

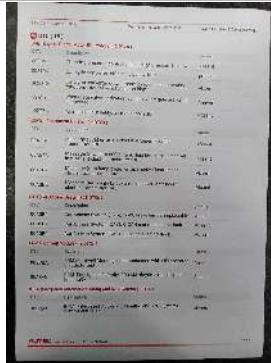

Diagnostic test

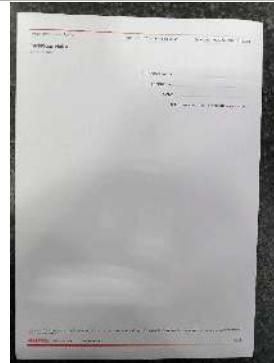

Diagnostic test



FRONT RIGHT CORNER



REAR LEFT CORNER



CONDITION REPORT

Report No: 2016376766

DATE
13/05/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksdorp, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WMWZC32020WN04475

4 / 10



CONDITION REPORT

Report No: 2016376766

DATE
13/05/2024

INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic



90 DEGREE FRONT



90 DEGREE RIGHT



CONDITION REPORT

Report No: 2016376766

DATE
13/05/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WMWZC32020WN04475

6 / 10



CONDITION REPORT

Report No: 2016376766

DATE
13/05/2024


90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD

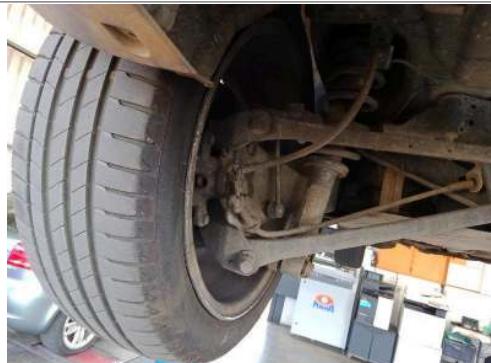

LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



CONDITION REPORT

Report No: 2016376766

DATE
13/05/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WMWZC32020WN04475
8 / 10



CONDITION REPORT

Report No: 201637676

DATE
13/05/2024


No sparewheel



LICENSE DISC



VIN PLATE OR STICKER

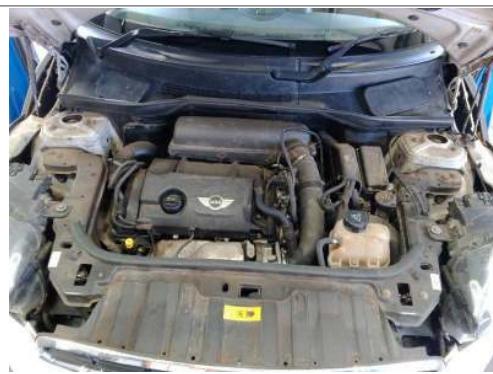

ENGINE 1



ENGINE 2



CHASSIS



CONDITION REPORT

Report No: 2016376766

DATE
13/05/2024



CONDITION REPORT

Report No: 2016376766

DATE
13/05/2024

Rear end



Tyre pressure warning lights i



Foreign substance on oil cap



Oil cap and dipstick



Expansion bottle



Water level



CONDITION REPORT

Report No: 2016376766

DATE
13/05/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016376766

DATE
13/05/2024

Engine



Engine



Rear bumper



Fog Light Front Right



Front Bumper



Front Bumper



CONDITION REPORT

Report No: 2016376766

DATE
13/05/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016376766

DATE
13/05/2024

Fog Light Front Left



Rim Front Left



Rim Front Left



Rear Fender Right



Tyre Front Left



Engine



CONDITION REPORT

Report No: 2016376766

DATE
13/05/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016376766

DATE
13/05/2024

Engine



Engine



Engine



Engine



Engine



Gearbox



CONDITION REPORT

Report No: 2016376766

DATE
13/05/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016376766

DATE
13/05/2024

Gearbox



Gearbox



Gearbox



Rim Rear Left



CONDITION REPORT

Report No: 2016376766

DATE
13/05/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za