



CONDITION REPORT



Report No:
2016992901
DATE
28/08/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	28/08/2025		M57 Pretoria Road - 1619
Inspection Date	28/08/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	VOLKSWAGEN	Registration Number	LM48ZPGP
Model	KOMBI T6.1 SWB 2.0 TDI TRENDLINE MPV DSL 110KW DSG [2021-2022]	Register Number	
VIN	WV2ZZZ7HZMH114718	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/06/2026
Color	SILVER	Power / Displacement	
Year Model	2021	Paint Finish	TWO COAT METALLIC
Km Reading	121,552 KM	Fuel	DIESEL
Cab / Body Type	STATION WAGON	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WV2ZZZ7HZMH114718



CONDITION REPORT



Report No:
2016992901
DATE
28/08/2025

	Damage	Repair Way
	Side Mirror Right Damaged	Replace
	Front Bumper Damaged	Repair
	Bonnet Damaged	Repair
	Front Fender Right Damaged	Repair
	Rear Fender Left Damaged	Repair
	Door Front Left Damaged	Repair
	Door Front Right Damaged	Repair
	Door Rear Left Damaged	Repair
	Door Rear Right Damaged	Repair
	Boot Lid / Hatch door Damaged	Repair
	Rear bumper Damaged	Repair
	Tyre Front Left Worn	Replace
	Tyre Rear Right Worn	Replace
	Belly plates Damaged	Repair

Brakes

Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	5.72	4.43	-	
Rear	3.0	2.96	-	
Emergency / Parking	2.23	2.36	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	235/55R17	103Y	Michelin	Radial	V	0223	0 mm
Front Right	235/55R17	103Y	Michelin	Radial	V	3724	3 mm
Rear Left	235/55R17	103Y	Michelin	Radial	V	5023	3 mm
Rear Right	235/55R17	103W	Michelin	Radial	V	2921	0 mm
Spare	235/55R17	103W	Bridgestone	Radial	V	0000	4 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WV2ZZZ7HZMH114718



CONDITION REPORT



Report No:
2016992901
DATE
28/08/2025

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENGINE CONTROL MODULE 1	P060C00	INTERNAL CONTROL UNIT MAIN PROCESSOR PERFORMANCE	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. 8 DTC'S AT TIME OF TESTING SEE DTC REPORT. Body • Exterior: Minor dents and scratches and stone chips to some body panels. Signs of repair work done to somebody panels. Poor alignment to somebody panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: WV2ZZZ7H2MH114718



CONDITION REPORT




Report No:
2016992901
DATE
28/08/2025

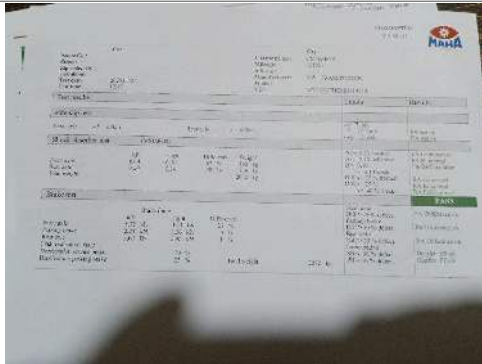

Brake test.



Diagnostic.

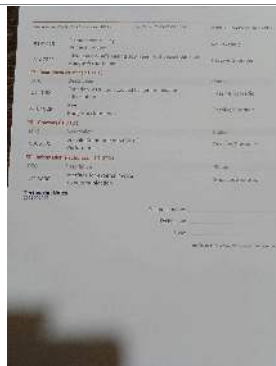

Diagnostic.



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WV2ZZZ7HZMH114718



CONDITION REPORT



Report No:
2016992901
DATE
28/08/2025



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic.



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WV2ZZZ7H2MH114718



CONDITION REPORT



Report No:
2016992901
DATE
28/08/2025




90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD

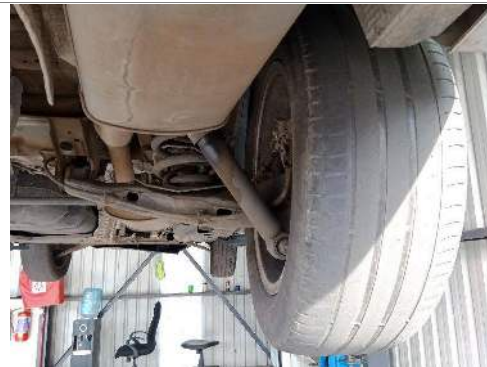

RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WV2ZZ7HZMH114718



CONDITION REPORT



Report No:
2016992901
DATE
28/08/2025



VIN PLATE OR STICKER



ENGINE 1



Undercarriage front.



Undercarriage rear.



Oil cap and dipstick.



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WV2ZZZ7HZMH114718



CONDITION REPORT



Report No:
2016992901
DATE
28/08/2025




Bonnet



Front Bumper



Front Bumper

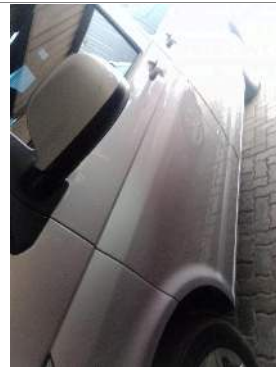

Door Front Left



Door Rear Left



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WV2ZZZ7H2MH114718



CONDITION REPORT



Report No:
2016992901
DATE
28/08/2025



Rear bumper



Boot Lid / Hatch door



Door Rear Right



Door Front Right



Front Fender Right



Rear Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WV2ZZZ7H2MH114718



CONDITION REPORT



Report No:
2016992901
DATE
28/08/2025



Side Mirror Right



Belly plates



Tyre Front Left



Tyre Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WV2ZZZ7H2MH114718