



CONDITION REPORT



Report No:
2016957350
DATE
24/07/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	25/07/2025		M57 Pretoria Road - 1619
Inspection Date	24/07/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	VOLKSWAGEN	Registration Number	HHT676MP
Model	TIGUAN 1.4 TSI TREND&FUN BLUEMOTION 90KW [2011-2015]	Register Number	
VIN	WVGZZZ5NZEW074471	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/10/2025
Color	GOLDEN	Power / Displacement	
Year Model	2014	Paint Finish	TWO COAT METALLIC
Km Reading	269,708 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: WVGZZZ5NZEW074471



CONDITION REPORT



Report No:
2016957350
DATE
24/07/2025

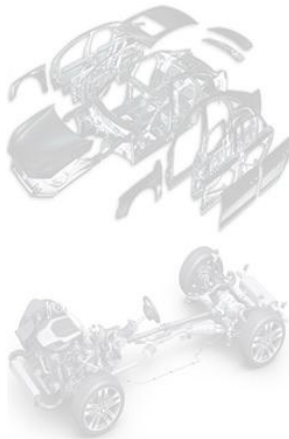

Damage	Repair Way
Engine Oil Leak	Repair
Fan Belt Defective	Replace
Under bonnet insulation cover Damaged	Repair
Central Air Vent Damaged	Replace
Center Console / Cubbyhole + Lid Damaged	Repair
Windscreen Wiper Damaged	Replace
Tail Light Left Cracked	Replace
Tail Light Right Cracked	Replace
Fog Light Front Left Damaged	Replace
Seat Front Left Damaged	Repair
Seat Front Right Damaged	Repair
Hood Lining Defective	Repair
Mirror Adjusters Damaged	Replace
Front Bumper Damaged	Repair
Bonnet Residual Traces of Repair	Repair
A • Pillar Left Residual Traces of Repair	Repair
A • Pillar Right Residual Traces of Repair	Repair
B • Pillar Right Dented	Repair
Front Fender Left Residual Traces of Repair	Repair
Front Fender Right Residual Traces of Repair	Repair
Rear Fender Left Residual Traces of Repair	Repair
Rear Fender Right Damaged	Repair
Front Fender Left / Inner Tray Damaged	Replace
Door Front Left Residual Traces of Repair	Repair
Door Front Right Residual Traces of Repair	Repair
Door Rear Left Residual Traces of Repair	Repair
Door Rear Right Residual Traces of Repair	Repair
Boot Lid / Hatch door Residual Traces of Repair	Repair
Rear bumper Damaged	Repair
Sill Panel Right Paintwork • Scratched	Repair
Parking Brake Performance Malfunction	Repair
Stabilizer Mounting Front Right Defective	Replace
Control Arm Bush(es) Front Axle Left Cracked	Replace
Control Arm Bush(es) Front Axle Right Cracked	Replace
Tyre Front Left Worn	Replace
Tyre Front Right Worn	Replace
Tyre Rear Left Worn	Replace
Tyre Rear Right Worn	Replace
Rim Front Left Scratched	Repair
Rim Front Right Scratched	Repair
Rim Rear Left Scratched	Repair
Rim Rear Right Scratched	Repair
Belly plates Damaged	Repair
Gearbox Oil Leak	Repair
Fuel Tank Defective	Repair
Clutch Operation Shudder	Repair
Jack Missing	Replace
Road test	Vibration coming from engine
Warning lights illuminated on dashboard	Repair

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZZ5NZEW074471



CONDITION REPORT



Report No:
2016957350
DATE
24/07/2025

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.41	3.39	-	
Rear	2.16	1.71	-	
Emergency / Parking	0.56	0.83	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	215/65 R16	98H	Lanvigator	Comfort	V	2122	0 mm
Front Right	215/65 R16	98H	Lanvigator	Comfort	V	2122	0 mm
Rear Left	215/65 R16C	109T	Hilo	Brawn	V	4920	0 mm
Rear Right	215/65 R16C	109T	Hilo	Brawn	V	4920	0 mm
Spare	T145/80 R18	99M	Continental	Temporary	V	4913	4 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	01-ENGINE CONTROL MODULE 1	P056200	SYSTEM VOLTAGE LOW VOLTAGE	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Poor residual traces of repair on some body panels. Stone chips and spray work on some body panels. Dents and scratches on some body panels. Some body panels misaligned.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZZ5NZEW074471

**CONDITION REPORT**

Report No:
2016957350
DATE
24/07/2025

strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: WVGZZZ5NZEW074471



CONDITION REPORT



Report No:
2016957350
DATE
24/07/2025

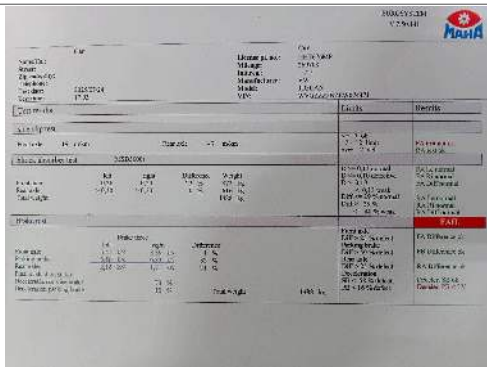


Brake and shock absorber repor



Diagnostic report page 1



Diagnostic report page 2

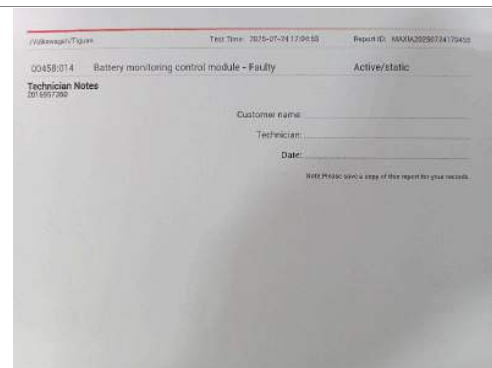

Diagnostic report page 3



FRONT RIGHT CORNER



REAR LEFT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZZ5NZEW074471



CONDITION REPORT



Report No:
2016957350
DATE
24/07/2025



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual Transmission



90 DEGREE FRONT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZZ5NZEW074471



CONDITION REPORT



Report No:
2016957350
DATE
24/07/2025



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZZ5NZEW074471



CONDITION REPORT



Report No:
2016957350
DATE
24/07/2025



Spare wheel and Accessories



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



Front chassis



Rear chassis

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZZ5NZEW074471



CONDITION REPORT



Report No:
2016957350
DATE
24/07/2025



Oil cap and dipstick




Center Console / Cubbyhole + Lid



Hood Lining



Parking Brake Performance

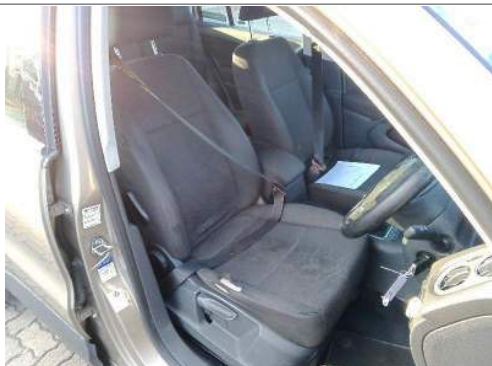

Seat Front Right



Central Air Vent

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVZZZ5NZEW074471



CONDITION REPORT



Report No:
2016957350
DATE
24/07/2025



Sill Panel Right



B • Pillar Right



Front Fender Right



Door Front Right



Door Rear Right



Rear Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZZ5NZEW074471



CONDITION REPORT



Report No:
2016957350
DATE
24/07/2025



Rear Fender Left



Door Rear Left



Door Front Left



Front Fender Left



Windscreen Wiper



Seat Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZZ5NZEW074471



CONDITION REPORT



Report No:
2016957350
DATE
24/07/2025



Fog Light Front Left



Front Bumper



Front Bumper



Bonnet



A • Pillar Right



A • Pillar Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZZ5NZEW074471



CONDITION REPORT



Report No:
2016957350
DATE
24/07/2025



Mirror Adjusters



Central Air Vent



Tail Light Left



Tail Light Right



Boot Lid / Hatch door



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZZ5NZEW074471




CONDITION REPORT



Report No:
2016957350
DATE
24/07/2025



Rear bumper

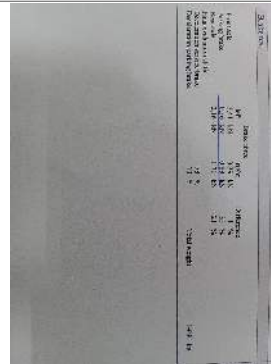

Parking Brake Performance



Rim Front Right



Rim Rear Right



Rim Rear Left



Rim Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZZ5NZEW074471



CONDITION REPORT



Report No:
2016957350
DATE
24/07/2025



Front Fender Left / Inner Tray



Belly plates



Gearbox



Engine



Control Arm Bush(es) Front Axle Left



Control Arm Bush(es) Front Axle Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZZ5NZEW074471



CONDITION REPORT



Report No:
2016957350
DATE
24/07/2025



Belly plates




Tyre Front Right



Tyre Front Left



Fuel Tank

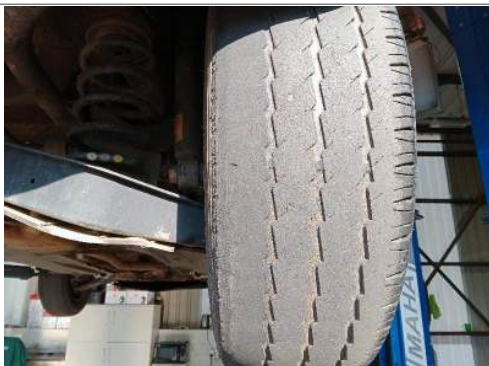

Tyre Rear Right



Tyre Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZZ5NZEW074471



CONDITION REPORT



Report No:
2016957350
DATE
24/07/2025



Stabilizer Mounting Front Right



Water level



Fan Belt



Under bonnet insulation cover

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVZZZ5NZEW074471