



CONDITION REPORT



Report No:
2017253236
DATE
11/06/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	11/06/2026		M57 Pretoria Road - 1619
Inspection Date	11/06/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	VOLKSWAGEN	Registration Number	JM78FJGP
Model	T-CROSS 1.0 TSI 85KW COMFORTLINE DSG [2019-2021]	Register Number	
		Date Of First Licensing	
VIN	WVGZZZC1ZLY100332	Last COR	
Engine Number		License Expiry Date	30/06/2025
Doors	5	Power / Displacement	
Color	BLACK	Paint Finish	M - METALLIC
Year Model	2020	Fuel	PETROL
Km Reading	180,690 KM	Transmission	AUTOMATIC
Cab / Body Type	HATCHBACK		

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZZC1ZLY100332



CONDITION REPORT



Report No:

2017253236

DATE

11/06/2026

Damage

Repair Way

Switch Electrical Window Winder front right Defective	Repair
Fog Light Front Left Defective	Repair
Seat Front Right Torn / Cut	Repair
Door Handle Front Right Missing	Replace
Parcel Tray Missing	Replace
Front Bumper Paintwork • Scratched	Repair
Grill Damaged	Replace
Front Fender Left Damaged	Replace
Rear Fender Right Residual Traces of Repair	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Dented	Repair
Windscreen Cracked	Replace
Tie Rod End left Damaged	Replace
Tie Rod End right Cracked	Replace
Bolt(s) / Nut(s) Rear Wheel Right Missing	Replace
Rear tyre size differs	Replace
warning lights illuminated	Repair
left front fender beading missing	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	1.8	2.9	-	
Rear	2.0	2.4	-	
Emergency / Parking	1.9	2	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	225/50R17	94W	Goodride	SA	V	2723	1 mm
Front Right	225/50R17	94W	Goodride	SA	V	2723	1 mm
Rear Left	205/55R16	91V	Continental	Contact	V	0320	5 mm
Rear Right	225/50R17	94W	Goodride	SA	V	2723	4 mm
Spare	225/45R17	94W	Goodride	SA	V	0000	3 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZC1ZLY100332



CONDITION REPORT



Report No:
2017253236
DATE
11/06/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENGINE CONTROL MODULE	P06E900	ENGINE STARTER PERFORMANCE	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Engine Compartment: Bottom of engine is fully covered.

Body • Exterior: Signs of spray work done on body panels.

Undercarriage: Undercarriage is fully covered.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: WVGZZC1ZLY100332



CONDITION REPORT




Report No:
2017253236
DATE
11/06/2026

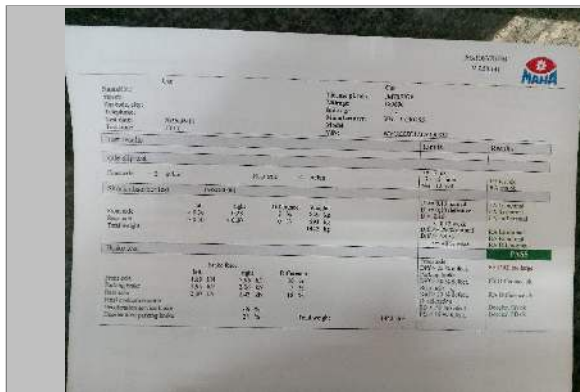

Shock and brake report




Diagnostic test

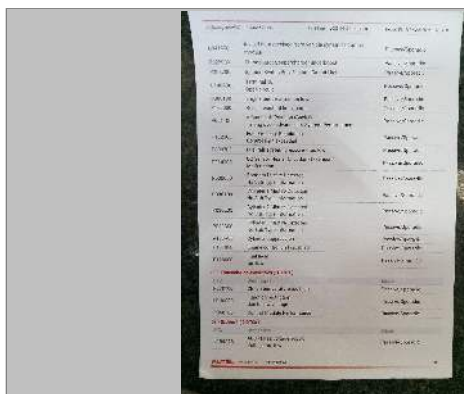


Diagnostic test



Diagnostic test

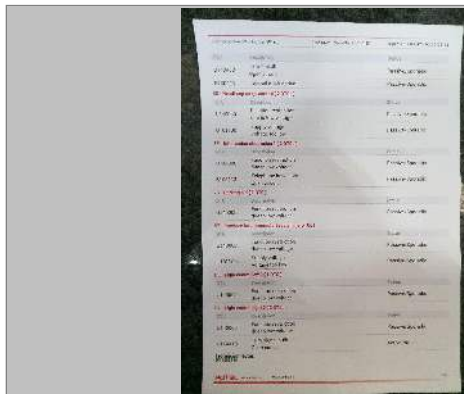

Diagnostic test

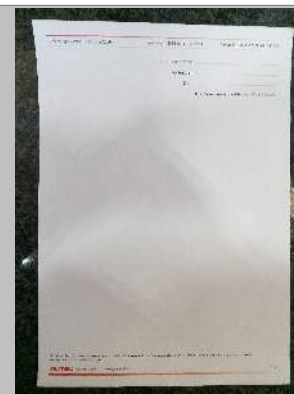

Diagnostic test

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZC1ZLY100332



CONDITION REPORT



Report No:
2017253236
DATE
11/06/2026



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZC1ZLY100332



CONDITION REPORT



Report No:
2017253236
DATE
11/06/2026



90 DEGREE FRONT



90 DEGREE RIGHT




90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD

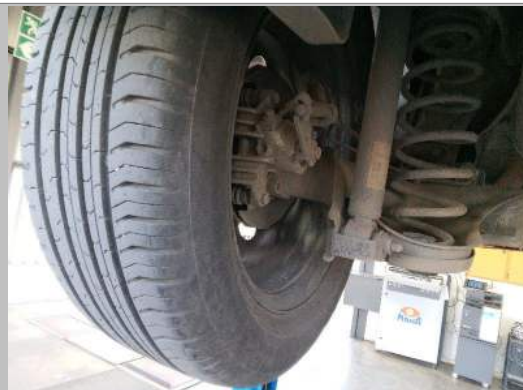

LR TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZC1ZLY100332



CONDITION REPORT



Report No:
2017253236
DATE
11/06/2026



RR TYRE TREAD



RF TYRE TREAD



Sparewheel



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZZC1ZLY100332



CONDITION REPORT



Report No:
2017253236
DATE
11/06/2026




ENGINE 2



REAR



CHASSIS

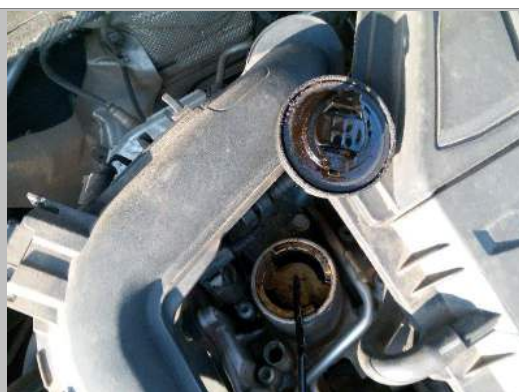

Oil cap and dipstick



Expansion bottle



Warning lights illuminated

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZC1ZLY100332



CONDITION REPORT



Report No:

2017253236

DATE

11/06/2026



Switch Electrical Window Winder front right



Windscreen



Windscreen



Door Rear Left



Parcel Tray



Rear Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: WVGZZC1ZLY100332



CONDITION REPORT



Report No:
2017253236
DATE
11/06/2026

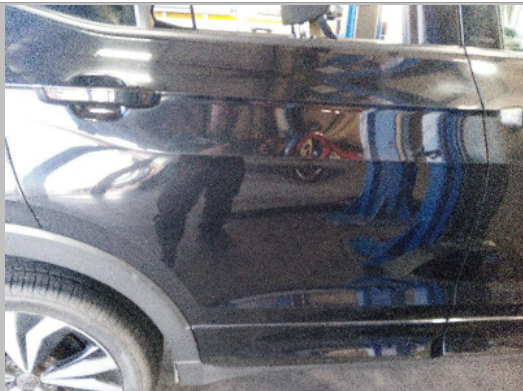

Door Rear Right



Door Handle Front Right



Water level



Front Bumper



Front Bumper



Grill

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZC1ZLY100332




CONDITION REPORT



Report No:
2017253236
DATE
11/06/2026



Fog Light Front Left

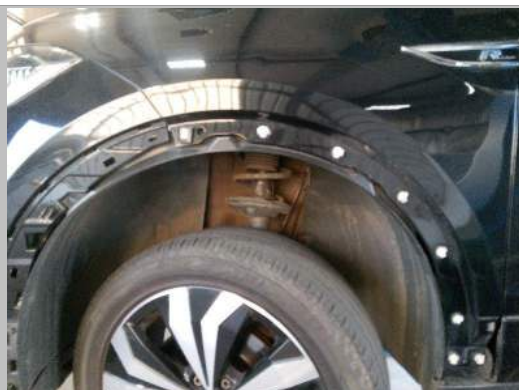

Front Fender Left



Bolt(s) / Nut(s) Rear Wheel Right



Tie Rod End left



Tie Rod End right



Seat Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZC1ZLY100332