



CONDITION REPORT

Report No: 2016206388

DATE
19/12/2023

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	19/12/2023		M57 Pretoria Road - 1619
Inspection Date	19/12/2023		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	VOLKSWAGEN	Registration Number	FWP833L
Model	T-CROSS	Register Number	
VIN	WVGZZC1ZNY109380	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/10/2024
Color	BLUE	Power / Displacement	
Year Model		Paint Finish	TWO COAT METALLIC
Km Reading	13,164 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Engine Oil Sweat	Repair
Seat Front Left Dirty	Repair
Seat Rear Dirty	Repair
Sun Visor Right Dirty	Repair
Hood Lining Dirty	Repair
Front Bumper Paintwork • Scratched	Repair
Bonnet Dented	Repair
C • Pillar Left Dented	Repair
Front Fender Left Dented	Repair
Front Fender Right Paintwork • Scratched	Repair
Rear Fender Left Dented	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Dented	Repair
Door Rear Right Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Roof Dented	Repair
Windscreen Chipped	Repair

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZC1ZNY109380



CONDITION REPORT

Report No: 2016206388

DATE
19/12/2023

Brakes

Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	3.03	3.22	-	
Rear	2.38	2.13	-	
Emergency / Parking	1.27	1.07	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	205/55 R17	91V	Hankook	Ventus	V	5121	4 mm
Front Right	205/55 R17	91V	Hankook	Ventus	V	5121	4 mm
Rear Left	205/55 R17	91V	Hankook	Ventus	V	5121	5 mm
Rear Right	205/55 R17	91V	Hankook	Ventus	V	5121	5 mm
Spare	T125/70 R18	99M	Linglong	Temporary	V	0522	3 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	01-ENGINE CONTROL MODULE 1	P119A00	FUEL PRESSURE SENSOR MALFUNCTION	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

Engine Compartment: Engine bay dirty. Brake fluid level ok.
Interior: Vehicle interior dirty and some interior panels scratched.
Body • Exterior: Vehicle antenna missing. Minor dents and scratches on some body panels. Spray work on some body panels. Some body panels misaligned. Stone chips on some body panels.
Tyres and Rims: Alloy rims scratched.
Undercarriage: Vehicle undercarriage dirty. Bottom of engine and gearbox fully covered.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.


General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.




CONDITION REPORT

Report No: 2016206388


DATE
19/12/2023

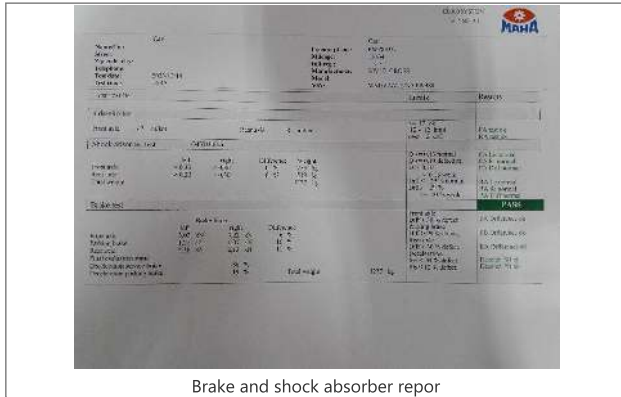

Brake and shock absorber report

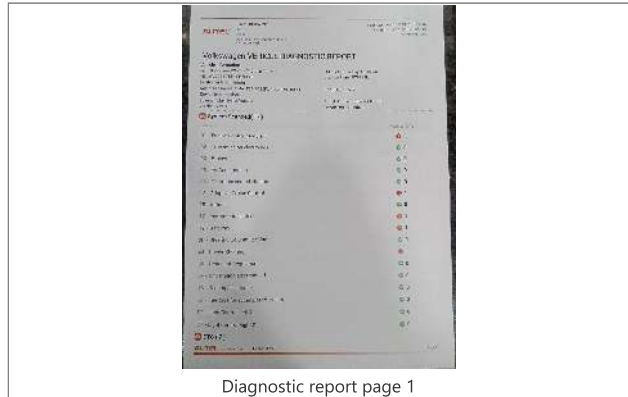

Diagnostic report page 1

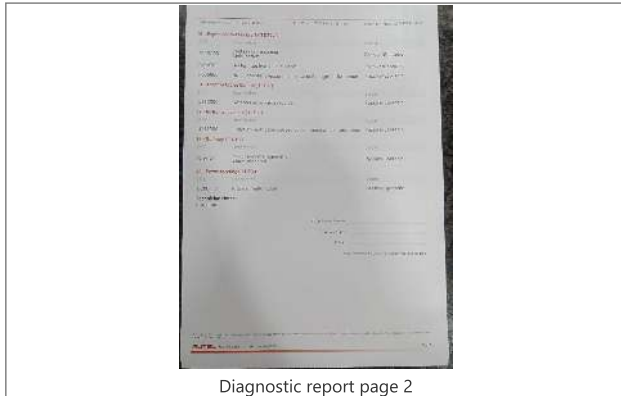

Diagnostic report page 2



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZC1ZNY109380

3 / 10



CONDITION REPORT

Report No: 2016206388

DATE
19/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZC1ZNY109380
4 / 10



CONDITION REPORT

Report No: 2016206388

DATE
19/12/2023



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZC1ZNY109380

5 / 10



CONDITION REPORT

Report No: 2016206388

DATE
19/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZC1ZNY109380
6 / 10



CONDITION REPORT

Report No: 2016206388

DATE
19/12/2023



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Spare wheel



Spare wheel Accessories

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZC1ZNY109380

7 / 10



CONDITION REPORT

Report No: 2016206388

DATE
19/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZC1ZNY109380

8 / 10



CONDITION REPORT

Report No: 2016206388

DATE
19/12/2023



LICENSE DISC



VIN PLATE OR STICKER




ENGINE 1



Front chassis



Rear chassis

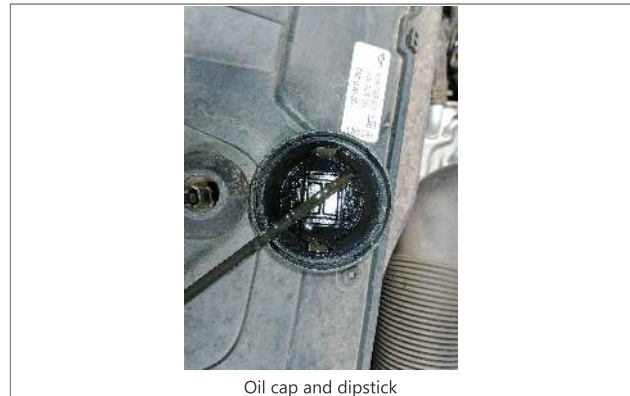

Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZC1ZNY109380

9 / 10



CONDITION REPORT

Report No: 2016206388

DATE
19/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZC1ZNY109380
10 / 10



CONDITION REPORT

Report No: 2016206388

DATE
19/12/2023



Automatic Transmission



Sun Visor Right



Hood Lining



Seat Rear



Seat Rear



Seat Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016206388

DATE
19/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016206388

DATE
19/12/2023



Front Bumper



Front Bumper



Bonnet



Rear bumper



Rear bumper



Roof

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016206388

DATE
19/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016206388

DATE
19/12/2023



Water level



Front Fender Right



Door Front Right



Door Rear Right



Door Rear Left



Door Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016206388

DATE
19/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016206388

DATE
19/12/2023



Front Fender Left



C • Pillar Left




Rear Fender Left



Windscreen



Water level

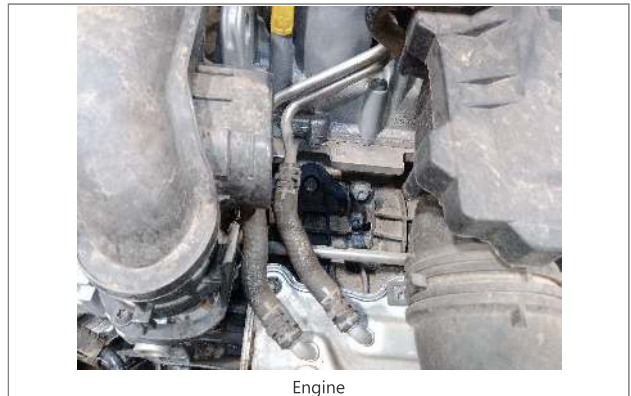

Engine

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016206388

DATE
19/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za