



CONDITION REPORT



Report No:
2017305784
DATE
01/10/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	01/10/2026		M57 Pretoria Road - 1619
Inspection Date	01/10/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	VOLKSWAGEN	Registration Number	KV07XMGP
Model	T-CROSS 1.5 TSI R-LINE DSG [2021-2023]	Register Number	
VIN	WVGZZC1ZNY123967	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/08/2025
Color	WHITE	Power / Displacement	
Year Model	2022	Paint Finish	TWO COAT UNI
Km Reading	57,970 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZC1ZNY123967



CONDITION REPORT



Report No:
2017305784
DATE
01/10/2026

Damage

Repair Way

Engine Management Lights Set	Repair
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
Rear Fender Left Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Damaged	Repair
Door Rear Right Damaged	Repair
Rear bumper Damaged	Repair
Windscreen Damaged	Replace
Tyre Front Right Worn	Replace
Spare Tyre Defective	Repair
Engine Smoke Excessive	Repair
Front tyres size differs	Replace



Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.37	3.5	-	
Rear	2.79	2.81	-	
Emergency / Parking	1.13	1.09	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	T125/70R18	99M	Linglong	Temporary	V	0922	2 mm
Front Right	215/45R18	89V	Hankook	Radial	V	0822	0 mm
Rear Left	215/45R18	89V	Hankook	Radial	V	0822	3 mm
Rear Right	215/45R18	89V	Hankook	Radial	V	0822	3 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZC1ZNY123967



CONDITION REPORT



Report No:
2017305784
DATE
01/10/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENGINE CONTROL MODULE 1	P044400	EVAPORATIVE EMISSION SYSTEM PURGE CONTROL	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. 25 DTC'S AT TIME OF TESTING SEE DTC REPORT / SIGNS OF REPAIR WORK DONE TO BODY PANELS. POOR ALIGNMENT TO SOMEBODY PANELS / BOTTOM OF ENGINE AND GEARBOX FULLY COVERED.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZC1ZNY123967



CONDITION REPORT



Report No:
2017305784
DATE
01/10/2026



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE FRONT



90 DEGREE REAR



90 DEGREE RIGHT



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZC1ZNY123967



CONDITION REPORT



Report No:
2017305784
DATE
01/10/2026



INTERIOR (FRONT DRIVER DOOR)



Automatic.



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



LICENSE DISC



VIN PLATE OR STICKER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZC1ZNY123967



CONDITION REPORT



Report No:
2017305784
DATE
01/10/2026



ENGINE 1



Undercarriage front.



Undercarriage rear.



Oil cap and dipstick.



LF TYRE TREAD



RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZC1ZNY123967



CONDITION REPORT




Report No:
2017305784
DATE
01/10/2026




LR TYRE TREAD




RR TYRE TREAD

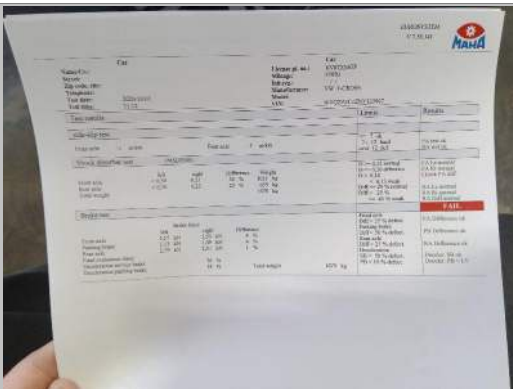


Brake test.

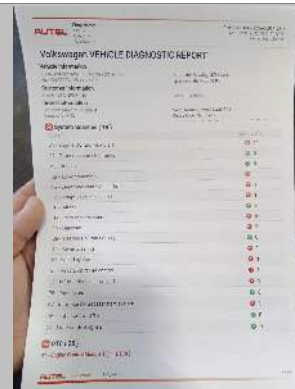

Diagnostic Report page 1

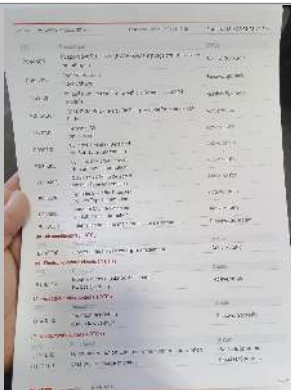

Diagnostic Report page 2

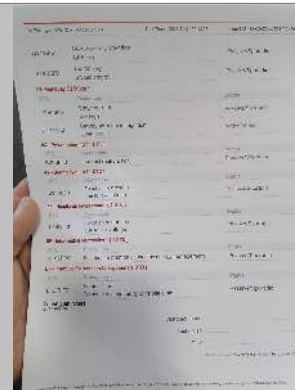

Diagnostic Report page 3

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVZZC1ZNY123967



CONDITION REPORT



Report No:
2017305784
DATE
01/10/2026



Engine Smoke



Water level



Front Bumper



Front Bumper



Bonnet



Door Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: WVGZZZC1ZNY123967



CONDITION REPORT



Report No:
2017305784
DATE
01/10/2026

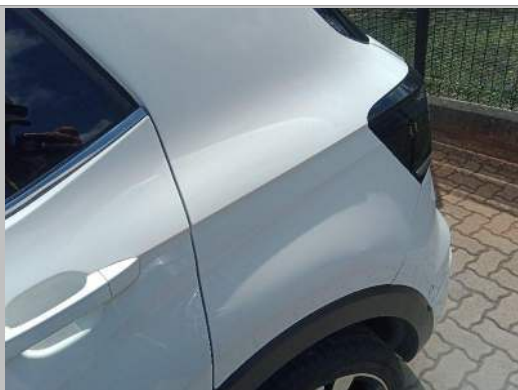

Rear Fender Left



Rear bumper



Rear bumper



Door Rear Right



Door Front Right



Windscreen

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZC1ZNY123967



CONDITION REPORT



Report No:
2017305784
DATE
01/10/2026



Spare Tyre



Engine Management Lights



Tyre Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZC1ZNY123967