



CONDITION REPORT

Report No: 2016879056

DATE
16/05/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	16/05/2025		M57 Pretoria Road - 1619
Inspection Date	16/05/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	VOLKSWAGEN	Registration Number	KB16WYGP
Model	POLO 1.4 TSI GTI 5-DR DSG [2011-2015]	Register Number	
VIN	WVWZZZ6RZDY024462	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/10/2025
Color	WHITE	Power / Displacement	
Year Model	2012	Paint Finish	C - COMMON
Km Reading	260,265 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Engine Oil Leak	Repair
Center Console / Cubbyhole + Lid Damaged	Repair
Headlight Left Defective	Repair
Headlight Right Damaged	Repair
Seat Front Right Torn / Cut	Repair
Side Mirror Right Paintwork • Scratched	Repair
Front Bumper Paintwork • Scratched	Repair
Bonnet Paintwork • Chipmarks	Repair
Front Fender Left Paintwork • Scratched	Repair
Front Fender Right Paintwork • Scratched	Repair
Rear Fender Left Dented	Repair
Rear Fender Right Dented	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Dented	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Paintwork • Scratched	Repair
Boot Lid / Hatch door Dented	Repair
Rear bumper Paintwork • Scratched	Repair
Sunroof Defective	Repair
Tie Rod End right Damaged	Replace

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVWZZZ6RZDY024462



CONDITION REPORT

Report No: 2016879056

DATE
16/05/2025

Damage	Repair Way
Shock Absorber Front Right Leak	Replace
Shock Absorber Rear Right Leak	Replace
Tyre Front Left Torn / Cut	Replace
Tyre Front Right Damaged	Replace
Spare Tyre Damaged	Replace
Silencer Missing	Replace
Gearbox Oil Leak	Repair
CV Joint(s) Boot(s) Front Left (inner/outer) Damaged	Replace
Gear Selections Insufficient	Repair
Clutch Operation Shudder	Repair
Engine management lights illuminated	Repair
Body exterior	Vehicle has minor scratches, stone chips and dents

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.1	3.1	-	
Rear	1.9	2.2	-	
Emergency / Parking	1.5	1.6	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	205/40R17	84W	Rapid	Eco819	V	2323	4 mm
Front Right	205/40R17	84W	Dura turn	Mozzo 4s	V	3819	0 mm
Rear Left	185/60R15	84H	Continental	Contact	V	0919	4 mm
Rear Right	205/40R17	84W	Dunlop	Sp sport	V	1114	3 mm
Spare	205/40R17	84W	Dura turn	Mozzo 4s	V	4119	0 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENGINE CONTROL MODULE	P111400	BANK 1, SENSOR 2 INTERNAL RESISTANCE TOO HIGH	
2	TRANSMISSION ELECTRONICS	P17BF:02/0-6079:002	HYDRAULIC PUMP. ANTI-PLAY PROTECTION	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL, AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZ6RZDY024462



CONDITION REPORT

Report No: 2016879056

DATE
16/05/2025**Technician**

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.


DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZ6RZDY024462



CONDITION REPORT

Report No: 2016879056

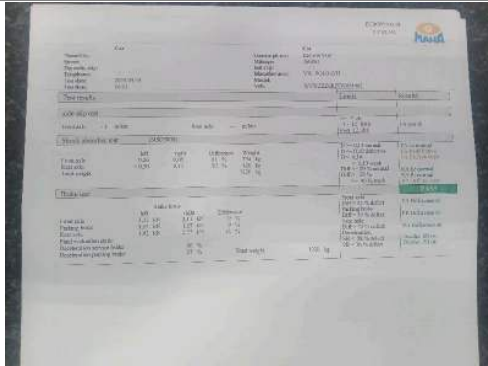DATE
16/05/2025

Shock and brake report




Diagnostic report



Diagnostic report



Diagnostic report

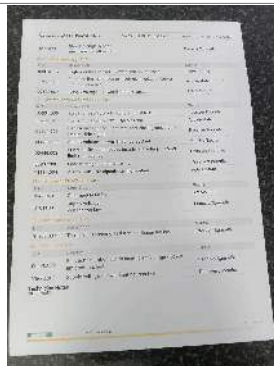

Diagnostic report



Diagnostic report

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WWWZZZ6RZDY024462



CONDITION REPORT

Report No: 2016879056

DATE
16/05/2025

Automatic



Expansion bottle



Oil cap and dipstick



Spare wheel fitted



FRONT RIGHT CORNER



REAR LEFT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZ6RZDY024462



CONDITION REPORT

Report No: 2016879056

DATE
16/05/2025

INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR


DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZ6RZDY024462



CONDITION REPORT


Report No: 2016879056

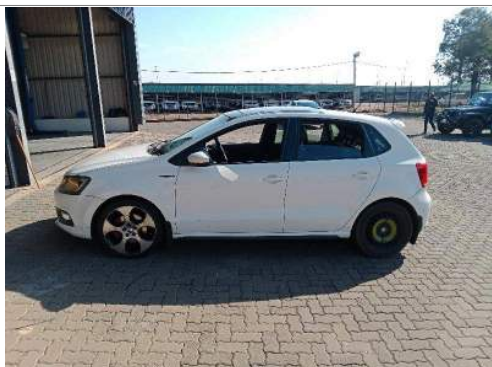DATE
16/05/2025

90 DEGREE LEFT



LF TYRE TREAD

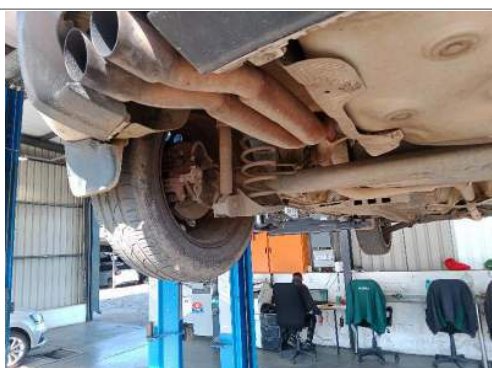

LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZ6RZDY024462



CONDITION REPORT

Report No: 2016879056

DATE
16/05/2025


VIN PLATE OR STICKER



CHASSIS



ENGINE 1

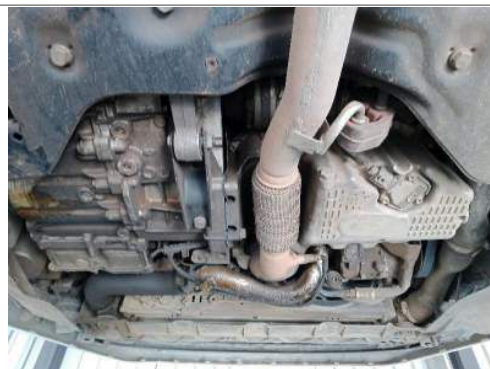

ENGINE 2



Water level



Headlight Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZ6RZDY024462



CONDITION REPORT

Report No: 2016879056

DATE
16/05/2025

Headlight Left



Bonnet



Gear Selections



Center Console / Cubbyhole + Lid



Spare Tyre



Seat Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZ6RZDY024462



CONDITION REPORT

Report No: 2016879056

DATE
16/05/2025

Rear Fender Right



Door Rear Right



Door Front Right



Side Mirror Right



Front Fender Right



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZ6RZDY024462



CONDITION REPORT

Report No: 2016879056

DATE
16/05/2025

Front Bumper



Front Fender Left



Door Front Left



Door Rear Left



Rear Fender Left



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZ6RZDY024462



CONDITION REPORT

Report No: 2016879056

DATE
16/05/2025

Rear bumper



Boot Lid / Hatch door



Shock Absorber Rear Right



Silencer



Gearbox



CV Joint(s) Boot(s) Front Left (inner/outer)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZ6RZDY024462



CONDITION REPORT

Report No: 2016879056

DATE
16/05/2025

Engine



Tyre Front Right



Tie Rod End right



Tyre Front Left



Shock Absorber Front Right



Sunroof

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZ6RZDY024462