



CONDITION REPORT



Report No:
2017304950
DATE
29/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	29/09/2026		M57 Pretoria Road - 1619
Inspection Date	29/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	VOLKSWAGEN	Registration Number	KY26FHGP
Model	UP! 1.0 TAKE UP! 5-DR [2016-2019]	Register Number	
VIN	WVWZZAAZJD137529	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/01/2027
Color	WHITE	Power / Displacement	
Year Model	2017	Paint Finish	C - COMMON
Km Reading	181,076 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVWZZAAZJD137529



CONDITION REPORT



Report No:

2017304950

DATE

29/09/2026

Damage

Repair Way

Switch Electrical Window Winder front right Malfunction	Repair
Dim Light Left Malfunction	Repair
Dim Light Right Malfunction	Repair
Front Bumper Paintwork • Scratched	Repair
Bonnet Paintwork • Chipmarks	Repair
Front Fender Left Paintwork • Scratched	Repair
Front Fender Right Paintwork • Chipmarks	Repair
Rear Fender Left Paintwork • Scratched	Repair
Rear Fender Right Dented	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Dented	Repair
Door Rear Left Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Windscreen Chipped	Repair
Tyre Rear Left Smooth	Replace
Engine to silencer pipe Welded	Repair
Body exterior	Vehicle got minor scratches, stone chips and dents
All four tires deferred name brand and sizes	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.1	2.4	-	
Rear	1.2	0.9	-	
Emergency / Parking	1.1	0.9	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	175/65R14	82H	Autogrip	P308 plus	V	4323	2 mm
Front Right	165/70R14	81T	Continental	Contact	V	4402	2 mm
Rear Left	155/65R13	73T	Hankook	Kinergy	V	4217	0 mm
Rear Right	165/65R14	82H	Road king	Argos	V	4624	2 mm
Spare	165/70R14	85T	Michelin	Radial	V	0000	3 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: WWWZZAAZJD137529



CONDITION REPORT



Report No:
2017304950
DATE
29/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	PASSIVE SPORADIC	P308100	ENGINE TEMPERATURE TOO LOW	

Inspection Conditions

No Test Drive
Rain at time of inspection
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WWWZZAAZJD137529



CONDITION REPORT



Report No:

2017304950

DATE

29/09/2026

Client Information		Vehicle Information	
Name: Mr. J. J. J.	Address: 123 Main St, Pretoria	Make: Volkswagen	Model: Polo
Phone: 012 345 678	Email: j.j.j@example.co.za	Year: 2015	Color: Silver
Insurer: ABC Insurance		VIN: WVWZZZAAZJD137529	

Test	Result	Pass/Fail
Shock absorbers	Good	Pass
Brake pads	Worn	Fail
Brake discs	Good	Pass
Stabilizer bar	Good	Pass
Struts	Good	Pass
Coilovers	Good	Pass
Control arms	Good	Pass
CV Axles	Good	Pass
Steering rack	Good	Pass
Power steering	Good	Pass
Brake master cylinder	Good	Pass
Brake booster	Good	Pass
Brake lines	Good	Pass
Brake hoses	Good	Pass
Brake fluid	Good	Pass
Brake pads (front)	Worn	Fail
Brake pads (rear)	Good	Pass
Brake discs (front)	Good	Pass
Brake discs (rear)	Good	Pass
Stabilizer bar (front)	Good	Pass
Stabilizer bar (rear)	Good	Pass
Struts (front)	Good	Pass
Struts (rear)	Good	Pass
Coilovers (front)	Good	Pass
Coilovers (rear)	Good	Pass
Control arms (front)	Good	Pass
Control arms (rear)	Good	Pass
CV Axles (front)	Good	Pass
CV Axles (rear)	Good	Pass
Steering rack	Good	Pass
Power steering	Good	Pass
Brake master cylinder	Good	Pass
Brake booster	Good	Pass
Brake lines	Good	Pass
Brake hoses	Good	Pass
Brake fluid	Good	Pass

Shock and brake report

Diagnostic Report	
Engine	Good
Transmission	Good
Clutch	Good
Brake	Good
Stabilizer	Good
Struts	Good
Coilovers	Good
Control arms	Good
CV Axles	Good
Steering rack	Good
Power steering	Good
Brake master cylinder	Good
Brake booster	Good
Brake lines	Good
Brake hoses	Good
Brake fluid	Good
Brake pads (front)	Worn
Brake pads (rear)	Good
Brake discs (front)	Good
Brake discs (rear)	Good
Stabilizer bar (front)	Good
Stabilizer bar (rear)	Good
Struts (front)	Good
Struts (rear)	Good
Coilovers (front)	Good
Coilovers (rear)	Good
Control arms (front)	Good
Control arms (rear)	Good
CV Axles (front)	Good
CV Axles (rear)	Good
Steering rack	Good
Power steering	Good
Brake master cylinder	Good
Brake booster	Good
Brake lines	Good
Brake hoses	Good
Brake fluid	Good

Diagnostic report

Diagnostic Report	
Engine	Good
Transmission	Good
Clutch	Good
Brake	Good
Stabilizer	Good
Struts	Good
Coilovers	Good
Control arms	Good
CV Axles	Good
Steering rack	Good
Power steering	Good
Brake master cylinder	Good
Brake booster	Good
Brake lines	Good
Brake hoses	Good
Brake fluid	Good
Brake pads (front)	Worn
Brake pads (rear)	Good
Brake discs (front)	Good
Brake discs (rear)	Good
Stabilizer bar (front)	Good
Stabilizer bar (rear)	Good
Struts (front)	Good
Struts (rear)	Good
Coilovers (front)	Good
Coilovers (rear)	Good
Control arms (front)	Good
Control arms (rear)	Good
CV Axles (front)	Good
CV Axles (rear)	Good
Steering rack	Good
Power steering	Good
Brake master cylinder	Good
Brake booster	Good
Brake lines	Good
Brake hoses	Good
Brake fluid	Good

Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WWWZZZAAZJD137529



CONDITION REPORT



Report No:
2017304950
DATE
29/09/2026



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WWWZZAAZJD137529



CONDITION REPORT



Report No:
2017304950
DATE
29/09/2026



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Spare wheel

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WWWZZAAZJD137529



CONDITION REPORT



Report No:
2017304950
DATE
29/09/2026



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZAAZJD137529



CONDITION REPORT



Report No:
2017304950
DATE
29/09/2026



Expection bottle



Water level



Bonnet



Windscreen



Dim Light Left



Dim Light Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WWWZZAAZJD137529



CONDITION REPORT



Report No:
2017304950
DATE
29/09/2026



Switch Electrical Window Winder front right



Rear Fender Right



Door Front Right



Front Fender Right



Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZAAZJD137529



CONDITION REPORT



Report No:
2017304950
DATE
29/09/2026



Front Fender Left



Door Front Left



Door Rear Left



Rear Fender Left



Rear bumper



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WWWZZAAZJD137529




CONDITION REPORT



Report No:
2017304950
DATE
29/09/2026



Engine to silencer pipe

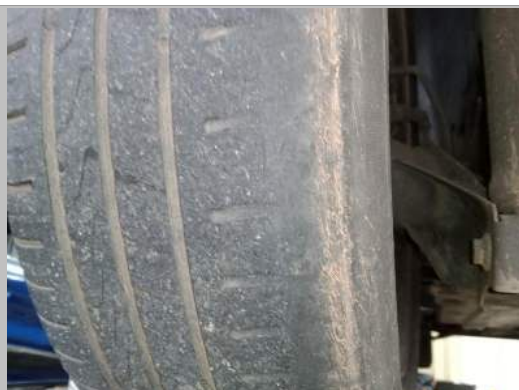

Tyre Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZAAZJD137529