



CONDITION REPORT



Report No:
2016963030
DATE
30/07/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	30/07/2025		M57 Pretoria Road - 1619
Inspection Date	30/07/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	VOLKSWAGEN	Registration Number	FB81CWGP
Model	GOLF 7 R 2.0 TSI 206KW 4MOTION 5-DR DSG [2015-2017]	Register Number	
VIN	WVWZZZAUZGW160271	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/10/2025
Color	PURPLE	Power / Displacement	
Year Model	2016	Paint Finish	M - METALLIC
Km Reading	216,807 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: WVWZZZAUZGW160271



CONDITION REPORT



Report No:
2016963030
DATE
30/07/2025

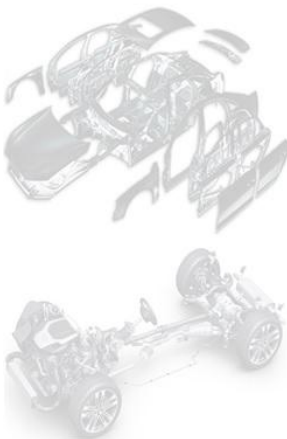

Damage	Repair Way
Engine Oil Leak	Repair
Seat Front Left Torn / Cut	Repair
Front Bumper Paintwork • Flaking	Repair
Front Fender Left Residual Traces of Repair	Repair
Front Fender Right Residual Traces of Repair	Repair
Rear Fender Right Residual Traces of Repair	Repair
Rear bumper Damaged	Repair
Windscreen Cracked	Repair
Brake disc 1. Axle left Worn	Replace
Brake disc 1. Axle right Corrosion	Repair
Tyre Rear Right Smooth	Replace
Engine to silencer pipe Welded	Replace
Catalytic converter Missing	Replace
Aftermarket exhaust system fitted	Repair

Brakes

Brake Test Results

No Brake Test on a brake test machine has been performed.

	Left	Right	Axle Weight [KG]	Deceleration [m/s²]
	Braking Force [KN]	Braking Force [KN]		
Front	-	-	-	
Rear	-	-	-	
Emergency / Parking	-	-	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	235/35R19	91W	Royal Black	Performance	V	3224	1 mm
Front Right	235/35R19	91W	Royal Black	Performance	V	1724	3 mm
Rear Left	235/35R19	91W	Royal black	Performance	V	1724	4 mm
Rear Right	235/35R19	91Y	Pirelli	Pzero	V	0000	1 mm
Spare	T125/70R18	99M	Continental	Temporary	V	0000	2 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VVWZZZAUZGW160271



CONDITION REPORT



Report No:
2016963030
DATE
30/07/2025

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	DRIVER'S DOOR ELECTRONICS	B177501	DOOR WARNING LIGHT ENTRY LIGHT ELECTRIC ERROR	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Residual traces of repair work done on some body panels. Signs of spray work done on some body panels. Axle and Suspension: Both front control arm bushes covered. Undercarriage: Undercarriage is covered.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: VVWZZZAUZGW160271



CONDITION REPORT



Report No:
2016963030
DATE
30/07/2025

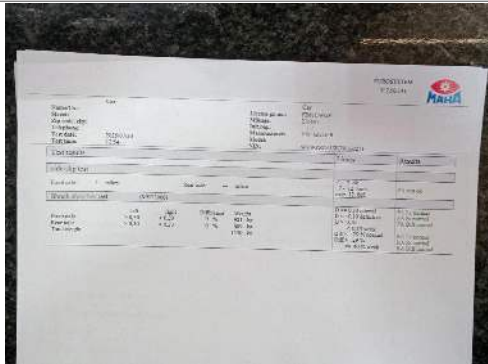


Shock test



Diagnostic test



Diagnostic test

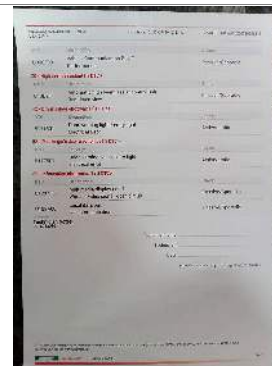

Diagnostic test



FRONT RIGHT CORNER



REAR LEFT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZAUZGW160271



CONDITION REPORT



Report No:
2016963030
DATE
30/07/2025



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic



90 DEGREE FRONT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVWZZZAUZGW160271



CONDITION REPORT



Report No:
2016963030
DATE
30/07/2025




90 DEGREE REAR




90 DEGREE LEFT



LF TYRE TREAD

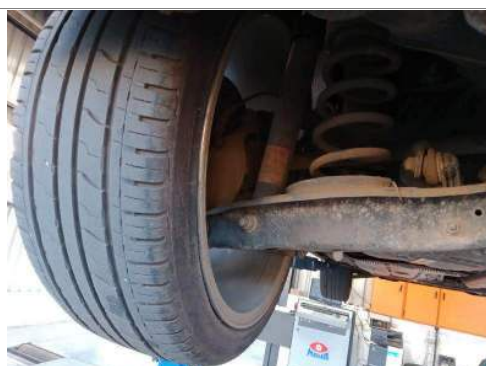

LR TYRE TREAD

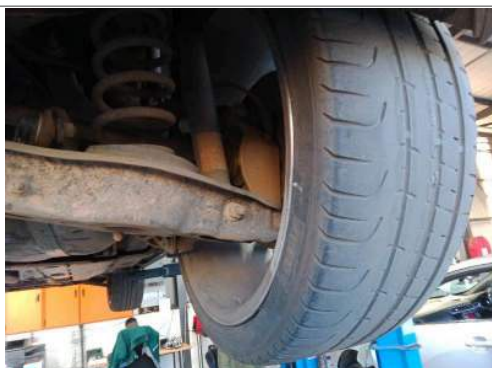

RR TYRE TREAD



RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZAUZGW160271



CONDITION REPORT



Report No:
2016963030
DATE
30/07/2025



Sparewheel



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZAUZGW160271



CONDITION REPORT



Report No:
2016963030
DATE
30/07/2025



Rear end



L/F quarter window rubber miss



Oil cap and dipstick



Expansion bottle



Tyre pressure warning lights i



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VVWZZZAUZGW160271



CONDITION REPORT



Report No:
2016963030
DATE
30/07/2025




Front Fender Right



Windscreen




Windscreen

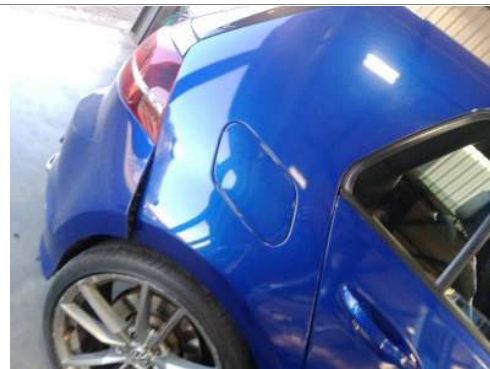

Rear Fender Right



Rear bumper

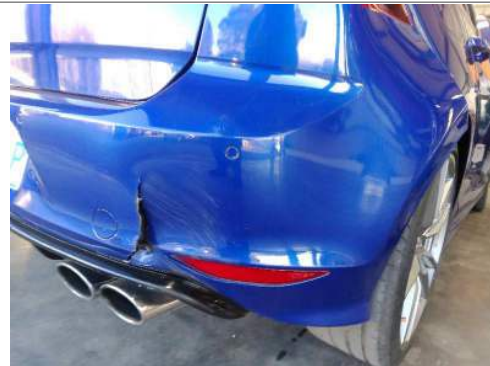

Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: VVWZZZAUZGW160271




CONDITION REPORT



Report No:
2016963030
DATE
30/07/2025

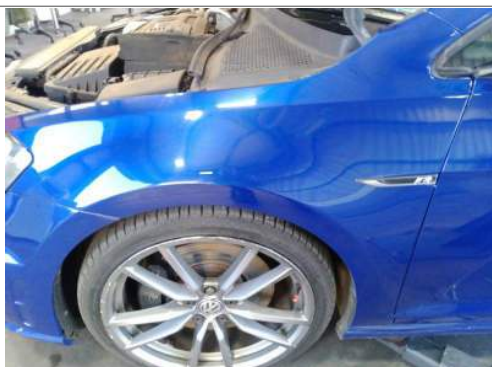

Front Fender Left

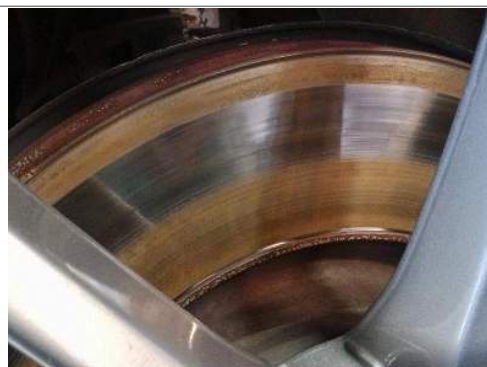

Brake disc 1. Axle right



Front Bumper



Front Bumper



Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VVWZZZAUZGW160271




CONDITION REPORT



Report No:
2016963030
DATE
30/07/2025



Front Bumper

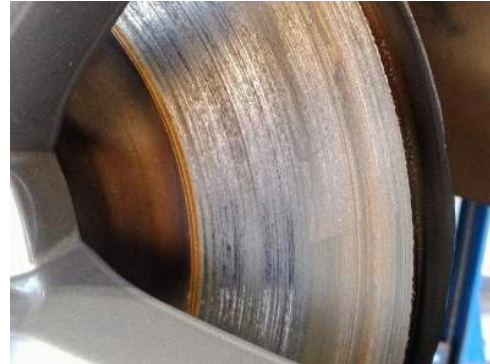

Brake disc 1. Axle left



Engine



Engine



Catalytic converter



Engine to silencer pipe

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VVWZZZAUZGW160271



CONDITION REPORT



Report No:
2016963030
DATE
30/07/2025



Engine to silencer pipe



Engine to silencer pipe



Engine to silencer pipe



Engine to silencer pipe



Tyre Rear Right



Seat Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZAUZGW160271