



CONDITION REPORT



Report No:
2017304167
DATE
28/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	28/09/2026		M57 Pretoria Road - 1619
Inspection Date	28/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	VOLKSWAGEN	Registration Number	LW87YMGP
Model	GOLF 7 2.0 TSI GTI 5-DR DSG [2017-2019]	Register Number	
VIN	WWWZZZAUZJW281444	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/12/2026
Color	SILVER	Power / Displacement	
Year Model	2018	Paint Finish	M - METALLIC
Km Reading	135,537 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: WWWZZZAUZJW281444



CONDITION REPORT



Report No:
2017304167
DATE
28/09/2026

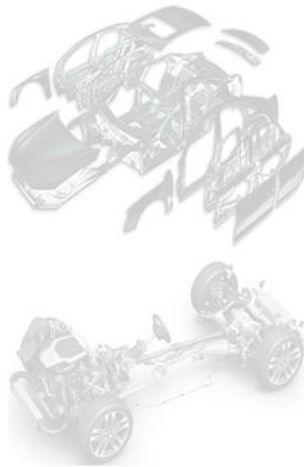

Damage	Repair Way
Engine Oil Leak	Repair
Hoses Defective	Repair
Front Bumper Residual Traces of Repair	Repair
Bonnet Residual Traces of Repair	Repair
Front Fender Left Residual Traces of Repair	Repair
Front Fender Right Residual Traces of Repair	Repair
Rear Fender Left Paintwork • Scratched	Repair
Rear bumper Paintwork • Flaking	Repair
Tyre Rear Left Smooth	Replace
Tyre Rear Right Smooth	Replace
Spare Tyre Excessive Wear & Tear	Replace
Engine to silencer pipe Welded	Repair
Silencer Welded	Replace
Catalytic converter Missing	Replace
Gearbox Oil Leak	Repair
CV Joint(s) Boot(s) Front Left (inner/outer) Damaged	Replace
Aftermarket exhaust system	Repair
Warning light illuminated	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	4.0	4.1	-	
Rear	2.2	2.5	-	
Emergency / Parking	0.5	0.5	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	225/40R18	92Y	Royal Black	Explorer	V	1526	3 mm
Front Right	225/40R18	92Y	Royal Black	Explorer	V	0326	3 mm
Rear Left	225/40R18	92W	Wanli	Sport	V	2224	0 mm
Rear Right	225/40R18	92W	Wanli	Sport	V	2224	0 mm
Spare	T125/70R18	99M	Ling long	Temporary	V	0000	0 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZAUZJW281444

**CONDITION REPORT**

Report No:
2017304167
DATE
28/09/2026

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. BODY EXTERIOR - RESIDUAL TRACES OF REPAIR WORK ON BODY PANELS / SIGNS OF SPRAY WORK DONE ON BODY.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZAUZJW281444



CONDITION REPORT



Report No:

2017304167

DATE

28/09/2026



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE FRONT



90 DEGREE REAR



90 DEGREE RIGHT



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZAUZJW281444



CONDITION REPORT



Report No:
2017304167
DATE
28/09/2026



INTERIOR (FRONT DRIVER DOOR)



Automatic transmission



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



VIN PLATE OR STICKER



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZAUZJW281444



CONDITION REPORT



Report No:
2017304167
DATE
28/09/2026



ENGINE 1



ENGINE 2



CHASSIS



REAR



Expansion bottle



Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: WVVZZAUZJW281444



CONDITION REPORT



Report No:
2017304167
DATE
28/09/2026

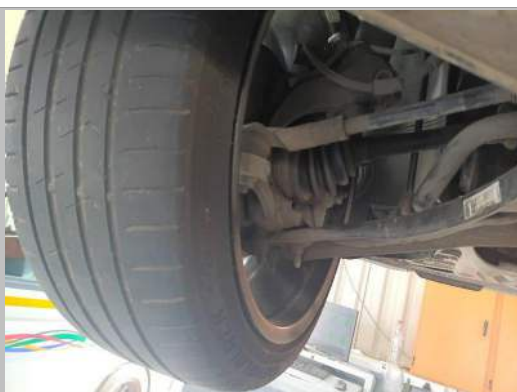

LF TYRE TREAD



RF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



Sparewheel



Shock and brake report

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZAUZJW281444



CONDITION REPORT



Report No:

2017304167

DATE

28/09/2026




Diagnostic Report page 1



Diagnostic Report page 2



Diagnostic Report page 3

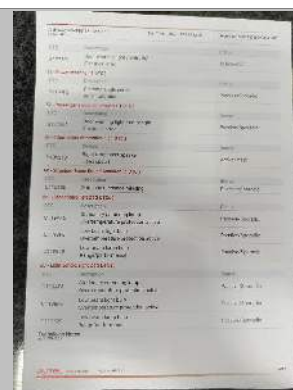

Diagnostic Report page 4



Diagnostic Report page 5



Warning lights illuminated

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZAUZJW281444



CONDITION REPORT



Report No:
2017304167
DATE
28/09/2026



Warning lights illuminated



Front Fender Right



Rear bumper



Rear bumper



Spare Tyre



Spare Tyre

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZAUZJW281444



CONDITION REPORT



Report No:
2017304167
DATE
28/09/2026



Front Fender Left



Bonnet



Catalytic converter



Water level



Hoses



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZAUZJW281444



CONDITION REPORT



Report No:
2017304167
DATE
28/09/2026



Front Bumper



Front Bumper



Rear Fender Left



Rear bumper



CV Joint(s) Boot(s) Front Left (inner/outer)



Gearbox

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZAUZJW281444



CONDITION REPORT



Report No:
2017304167
DATE
28/09/2026




Gearbox




Engine




Engine

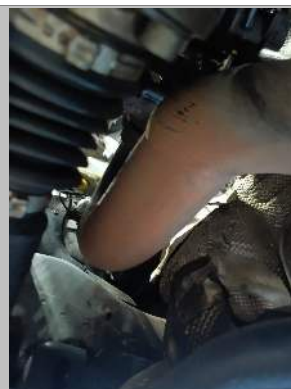

Catalytic converter

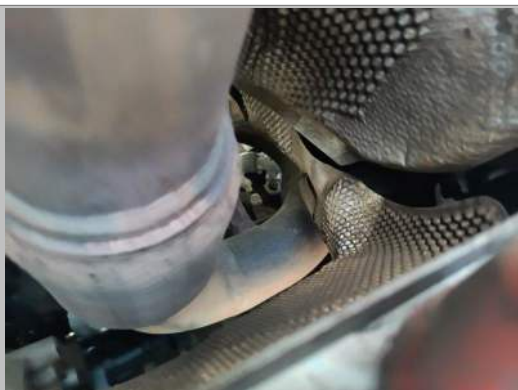

Catalytic converter

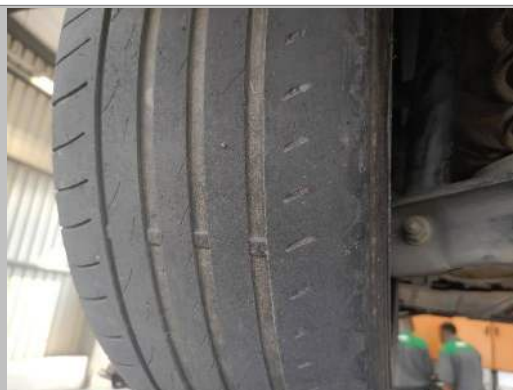

Tyre Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZAUZJW281444



CONDITION REPORT



Report No:
2017304167
DATE
28/09/2026



Tyre Rear Right



Silencer



Engine to silencer pipe



Engine to silencer pipe

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZAUZJW281444