



CONDITION REPORT

Report No: 2016813824

DATE
25/03/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	25/03/2025		M57 Pretoria Road - 1619
Inspection Date	25/03/2025		Kempton Park - GT


Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	VOLKSWAGEN	Registration Number	JRR759MP
Model	GOLF 7 1.4 TSI COMFORTLINE BLUEMOTION	Register Number	
	92KW 5-DR DSG [2017-2019]	Date Of First Licensing	
VIN	WVWZZZAUZJW306165	Last COR	
Engine Number		License Expiry Date	
Doors	5	Power / Displacement	
Color	BLUE	Paint Finish	TWO COAT UNI
Year Model	2018	Fuel	PETROL
Km Reading	163,215 KM	Transmission	AUTOMATIC
Cab / Body Type	HATCHBACK		

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

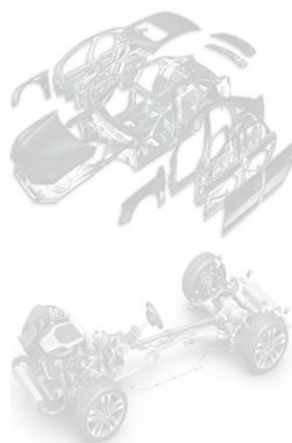

Damage	Repair Way
Hoses Defective	Replace
Radio/CD/USB Defective	Repair
Center Console / Cubbyhole + Lid Defective	Repair
Tail Light Right Scratched	Repair
Headlight Left Damaged	Replace
Headlight Right Damaged	Replace
Seat Front Left Damaged	Repair
Seat Front Right Damaged	Repair
Seat Rear Damaged	Repair
Hood Lining Damaged	Repair
Steering Wheel Trim Defective	Repair
Side Mirror Left Paintwork • Scratched	Repair
Side Mirror Right Paintwork • Scratched	Repair
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
B • Pillar Left Residual Traces of Repair	Repair
C • Pillar Left Damaged	Repair
C • Pillar Right Paintwork • Scratched	Repair
Front Fender Left Damaged	Repair

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVWZZZAUZJW306165



CONDITION REPORT

Report No: 2016813824

DATE
25/03/2025

Damage	Repair Way
Front Fender Right Damaged	Repair
Rear Fender Left Dented	Repair
Rear Fender Right Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Damaged	Repair
Door Rear Left Residual Traces of Repair	Repair
Door Rear Right Paintwork • Scratched	Repair
Boot Lid / Hatch door Damaged	Repair
Rear bumper Damaged	Repair
Sill Panel Left Residual Traces of Repair	Repair
Sill Panel Right Paintwork • Scratched	Repair
Control Arm Bush(es) Front Axle Right Cracked	Replace
Tyre Front Right Damaged	Replace
Tyre Rear Left Defective	Replace
Spare Tyre Damaged	Replace
Rim Front Right Welded	Replace
Rim Rear Left Scratched	Repair
Rim Rear Right Dented	Repair
Rim Spare Wheel Dented	Repair
Bolt(s) / Nut(s) Rear Wheel Left Missing	Replace
Silencer Damaged	Repair
Belly plates Damaged	Replace
Airbag warning light illuminated on dashboard	Repair
Engine	Engine bay dirty.
Undercarriage	Vehicle undercarriage dirty
Undercarriage	Bottom of engine and gearbox fully covered.
Interior	Vehicle interior dirty and some panels scratched
Body and Exterior	Dents and scratches on some body panels
Body and Exterior	Poor residual traces of repair on some body panels
Body and Exterior	Stone chips and spray work on some body panels
Body and Exterior	Some body panels misaligned
Body and Exterior	Signs of impact damage to front of vehicle
Axle and suspension	Front and rear suspension noisy
Bonnet release handle damaged	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s²]
Front	3.24	3.14	-	
Rear	2.26	2.45	-	
Emergency / Parking	0.53	0.69	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	225/45Z R17	94W	Durun	L919		2023	1 mm
Front Right	225/45Z R17	94W	Lanvigator	Catchpower	V	1821	0 mm
Rear Left	225/45 R17	91Y	Matador	Radial	V	2317	2 mm
Rear Right	225/45 R17	91Y	Matador	Radial	V	2317	3 mm
Spare	225/45 R17	91Y	Metador	Radial	V	2317	4 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZAUZJW306165



CONDITION REPORT

Report No: 2016813824

 DATE
25/03/2025

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	01-ENGINE CONTROL MODULE 1	P308800	STARTER REPLAY ELECTRICAL FAULT IN CIRCUIT	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZAUZJW306165



CONDITION REPORT

Report No: 2016813824

DATE
25/03/2025

FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic Transmission

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZAUZJW306165



CONDITION REPORT

Report No: 2016813824

DATE
25/03/2025

90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZAUZJW306165



CONDITION REPORT

Report No: 2016813824

DATE
25/03/2025

RR TYRE TREAD



RF TYRE TREAD



Spare wheel and Accessories



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZAUZJW306165



CONDITION REPORT

Report No: 2016813824

DATE
25/03/2025

Front chassis



Rear chassis



Oil cap and dipstick



Bonnet release handle damaged



Center Console / Cubbyhole + Lid



Center Console / Cubbyhole + Lid

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZAUZJW306165



CONDITION REPORT

Report No: 2016813824

DATE
25/03/2025

Steering Wheel Trim



Hood Lining



Seat Front Right



Seat Rear



C • Pillar Right



Sill Panel Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZAUZJW306165



CONDITION REPORT

Report No: 2016813824

DATE
25/03/2025

Sill Panel Right



Front Bumper



Front Bumper



Bonnet



Seat Front Left



Sill Panel Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZAUZJW306165




CONDITION REPORT

Report No: 2016813824

DATE
25/03/2025

B • Pillar Left

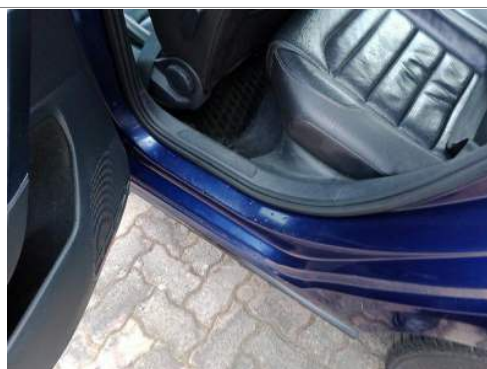

Sill Panel Left



C • Pillar Left



Rear bumper



Rear bumper



Boot Lid / Hatch door

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZAUZJW306165



CONDITION REPORT

Report No: 2016813824

DATE
25/03/2025

Tail Light Right



C • Pillar Left



Spare Tyre



Rim Spare Wheel



Headlight Right



Headlight Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZAUZJW306165



CONDITION REPORT

Report No: 2016813824

DATE
25/03/2025


Hoses



Front Fender Right



Side Mirror Right

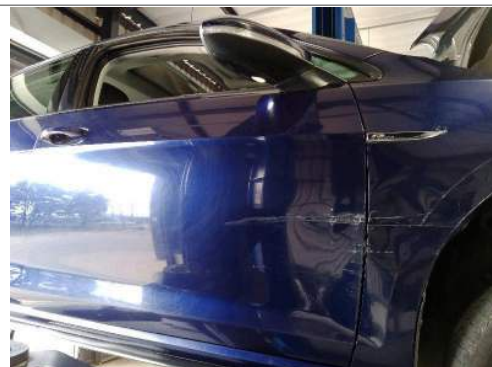

Door Front Right



Control Arm Bush(es) Front Axle Right



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZAUZJW306165



CONDITION REPORT

Report No: 2016813824

DATE
25/03/2025


Front Fender Left



Side Mirror Left



Door Front Left

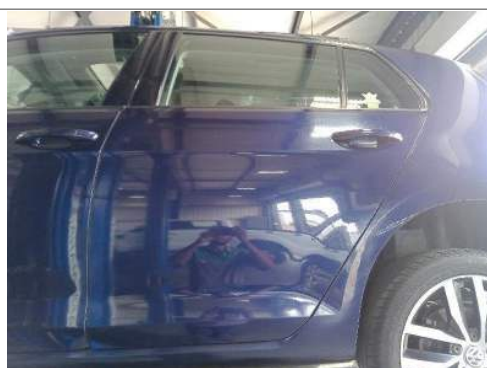

Door Rear Left



Rear Fender Left



Bolt(s) / Nut(s) Rear Wheel Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VVWZZZAUZJW306165



CONDITION REPORT

Report No: 2016813824

DATE
25/03/2025

Rim Rear Left



Tyre Rear Left



Rear Fender Right



Door Rear Right



Belly plates



Rim Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZAUZJW306165



CONDITION REPORT

Report No: 2016813824

DATE
25/03/2025

Tyre Front Right



Rim Rear Right



Silencer



Radio/CD/USB



Water level



Center Console / Cubbyhole + Lid

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZAUZJW306165



CONDITION REPORT

Report No: 2016813824

DATE
25/03/2025

Center Console / Cubbyhole + Lid



Steering Wheel Trim




Hood Lining



Seat Front Right



Seat Rear

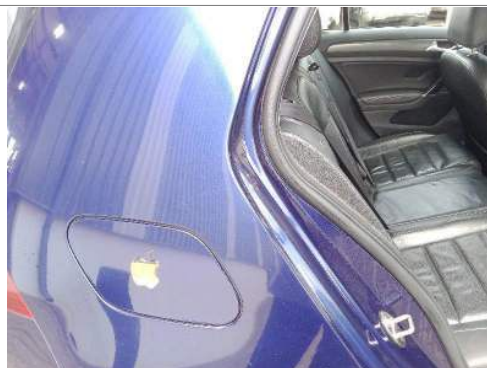

C • Pillar Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVWZZZAUZJW306165



CONDITION REPORT

Report No: 2016813824

DATE
25/03/2025

Sill Panel Right



Sill Panel Right



Front Bumper



Front Bumper



Bonnet



Seat Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZAUZJW306165



CONDITION REPORT


Report No: 2016813824

DATE
25/03/2025

Sill Panel Left



B • Pillar Left

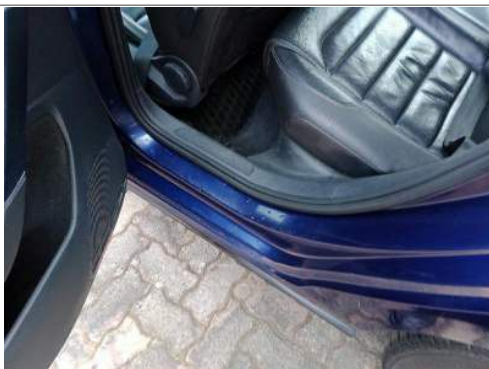

Sill Panel Left



C • Pillar Left



Rear bumper



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZAUZJW306165



CONDITION REPORT

Report No: 2016813824

DATE
25/03/2025

Boot Lid / Hatch door



Tail Light Right



C • Pillar Left



Spare Tyre



Rim Spare Wheel



Headlight Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZAUZJW306165



CONDITION REPORT

Report No: 2016813824

DATE
25/03/2025

Headlight Left



Hoses



Front Fender Right



Side Mirror Right



Door Front Right



Control Arm Bush(es) Front Axle Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZAUZJW306165



CONDITION REPORT

Report No: 2016813824

DATE
25/03/2025

Front Bumper



Front Fender Left



Side Mirror Left



Door Front Left



Door Rear Left



Rear Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZAUZJW306165



CONDITION REPORT

Report No: 2016813824

DATE
25/03/2025

Bolt(s) / Nut(s) Rear Wheel Left



Rim Rear Left



Tyre Rear Left



Rear Fender Right



Door Rear Right



Belly plates

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZAUZJW306165



CONDITION REPORT

Report No: 2016813824

DATE
25/03/2025

Rim Front Right



Tyre Front Right



Rim Rear Right



Silencer



Radio/CD/USB



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZAUZJW306165