



CONDITION REPORT



Report No:

2017296677

DATE

09/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	09/09/2026		- 1619
Inspection Date	09/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	MASERATI	Registration Number	KP75HYGP
Model	GHIBLI 3.0 TURBO DSL 8-SP AT [2015-2017]	Register Number	
VIN	ZAMTS57C001254720	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	
Color	WHITE	Power / Displacement	
Year Model	2019	Paint Finish	C - COMMON
Km Reading	50,203 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ZAMTS57C001254720



CONDITION REPORT



Report No:

2017296677


DATE

09/09/2026

Damage

Repair Way

Front Bumper Paintwork • Scratched	Repair
Bonnet Paintwork • Scratched	Repair
Front Fender Left Paintwork • Scratched	Repair
Front Fender Right Paintwork • Scratched	Repair
Rear Fender Left Paintwork • Chipmarks	Repair
Rear Fender Right Dented	Repair
Door Front Left Dented	Repair
Rear bumper Paintwork • Scratched	Repair
Engine Performance Idling / Hunting	Repair
Engine Noise Excessive	Repair
ABS and traction control light on	Repair

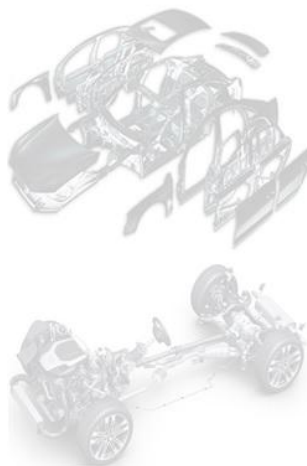

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	4.85	4.08	-	
Rear	3.34	4.03	-	
Emergency / Parking	2.38	2.66	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	245/40R20	99Y	Pirelli	Pzero	V	2122	3 mm
Front Right	245/40R20	99Y	Pirelli	Pzero	V	2022	3 mm
Rear Left	285/35R20	104Y	Pirelli	Pzero	V	2122	3 mm
Rear Right	285/35R20	104Y	Pirelli	Pzero	V	1023	3 mm
Spare	175/55-18	95P	Vredestein	Temporary	V	0000	4 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
 www.dekraauto.co.za

VIN: ZAMTS57C001254720



CONDITION REPORT



Report No:
2017296677
DATE
09/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ESC(ELECTRONIC STABILITY CONTROL)	690400	POWER BRAKE CALIPER IMPROPER POWERDOWN	ACTIVE

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ON THE BODY, INTERIOR, EXTERIOR, AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ZAMTS57C001254720



CONDITION REPORT



Report No:
2017296677
DATE
09/09/2026



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE LEFT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ZAMTS57C001254720



CONDITION REPORT



Report No:
2017296677
DATE
09/09/2026



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



AUTOMATIC GEAR LEVER



LF TYRE TREAD



RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ZAMTS57C001254720



CONDITION REPORT



Report No:
2017296677
DATE
09/09/2026



LR TYRE TREAD



RR TYRE TREAD



ENGINE 1



ENGINE 2



CHASSIS



OIL CAP AND DIPSTICK

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ZAMTS57C001254720



CONDITION REPORT



Report No:
2017296677
DATE
09/09/2026



COOLANT EXPANSION BOTTLE




SPARE WHEEL



LICENSE DISC



VIN PLATE OR STICKER

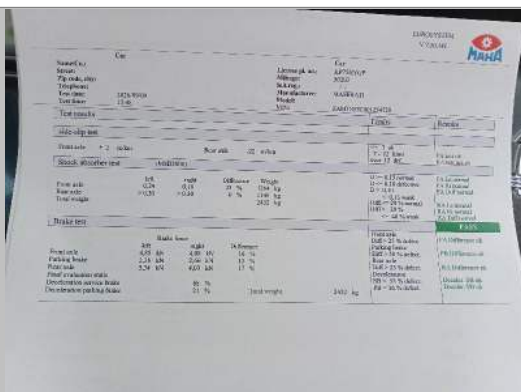

BRAKE AND SHOCK TEST REPORT



DIAGNOSTIC REPORT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ZAMTS57C001254720



CONDITION REPORT




Report No:


2017296677

DATE


09/09/2026

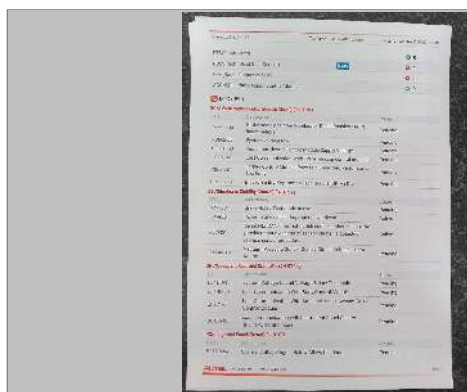

DIAGNOSTIC REPORT

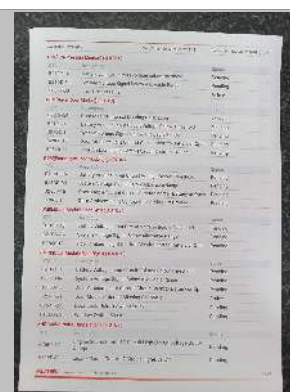

DIAGNOSTIC REPORT

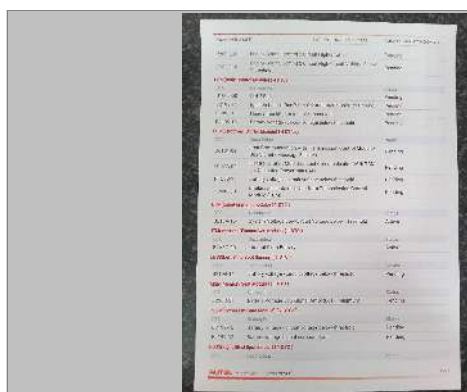

DIAGNOSTIC REPORT



DIAGNOSTIC REPORT



Water level



Bonnet

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ZAMTS57C001254720



CONDITION REPORT



Report No:
2017296677
DATE
09/09/2026



Front Bumper



Front Bumper



Front Bumper



Front Fender Right



Front Fender Left



Door Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ZAMTS57C001254720



CONDITION REPORT



Report No:
2017296677
DATE
09/09/2026




Rear Fender Left



Rear bumper



Rear bumper

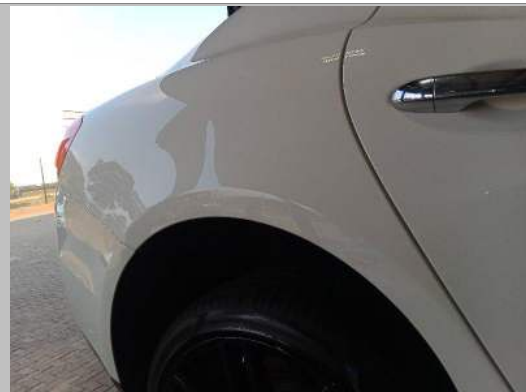

Rear Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ZAMTS57C001254720